Reference	SSM37759
Models	Range Rover Sport / L320
Title	Tyre tread pattern - Continental 4x4 Sport Contact tyres
Category	Chassis
Last modified	05-Jan-2015 00:00:00
Symptom	306000 Tyres/Wheels
Attachments	Continental tyre.pdf
Content	Issue.  A customer may report uneven tyre wear on vehicles fitted with 20 inch wheels and Continental 4x4 Sport Contact tyres.
	Cause.  With reference to the photo attached, Due to the tread pattern design of this tyre, there can appear to be inner or outer shoulder wear. This is in fact just the natural tread wear, but as the design of the lateral grooves continues around to the sidewall, the very ends of the grooves do not wear giving rise to a "band" of wear at the edge of the contact patch.
	Action.  Where applicable please review this SSM before carrying out tyre replacement or geometry adjustment under warranty as no action is required for this issue. It is deemed a characteristic of the tyre and not a fault.

