

<b>Reference</b>	SSM49497
<b>Models</b>	Range Rover Sport / L320
<b>Title</b>	Incorrect Replacement Of The Steering Gear Due to Leaks.
<b>Category</b>	Chassis
<b>Last modified</b>	05-Jan-2015 00:00:00
<b>Symptom</b>	303000 Steering/Handling
<b>Attachments</b>	Wagner valve 1.JPG Wagner valve 2.JPG

**Content**Issue:

An oil leak may be detected from the steering gear and incorrectly diagnosed as needing a replacement steering gear assembly.

Cause:

Leak from the Wagner/Steering gear damping valve or sealing washer (see attached photo's)

Action:

Before replacing any components, please check that the leak is not from this valve. If the leak is found to be the valve or its joints, replace using QFW500030 and claim service repair time 57.15.89/35 - 1.5 hrs.

More information regarding the replacement service procedure of these valves can be found in TSB LTB00021. TOPIx will be updated to include this replacement procedure in due course.



11 00:51



6H12-3K748-FA

7853 993 803



D38 KH

230211 004098



230211803010080

