

Reference	SSM55997
Models	Range Rover / L322 Range Rover Sport / L320
Title	Front Brake Pad Retaining Pins Difficult To Remove.
Category	Chassis
Last modified	05-Jan-2015 00:00:00
Symptom	301000 Service Brake System
Attachments	Brake pad retaining pins.pdf
Content	<p><u>Issue:</u> Upon replacement of the front brake pads, the brake pad retaining pins may be difficult to remove. Vehicles fitted with High Performance/Brembo brakes, post 10 Model Year Only. Range Rover Sport AA215623 to CA738069. Range Rover AA302697 to CA373799. Vehicles after the end VIN numbers quoted above will have the new pins fitted as standard.</p> <p><u>Cause:</u> Galvanic corrosion of the retaining pins. The pins now have a new plating which is more resistant to corrosion.</p> <p><u>Action:</u> The service part number LR016683 has not changed. All remaining stock of the current pins should be used. The new design retaining pins can be identified by the collar which is now light grey in appearance. Please see attached photo showing the new design pin on the left hand side.</p> <p>Refer to TOPIx section 206-03 - Front Disc Brake.</p>

