

|                      |  |
|----------------------|--|
| <b>Reference</b>     | SSM69738                                   |
| <b>Models</b>        | LR2 / L359<br>Range Rover Evoque / L538    |
| <b>Title</b>         | 2.0L gasoline camshaft sprocket pin broken |
| <b>Category</b>      | Engine                                     |
| <b>Last modified</b> | 05-Jan-2015 00:00:00                       |
| <b>Symptom</b>       | 499000 Basic Engine                        |
| <b>Attachments</b>   | 1.pdf                                      |

**Content** Issue: Evoque or Freelander 2 / LR2 2.0L gasoline engines - the customer reports Check Engine Lamp on with possible noise from the engine. The DTC that may be logged include P0016-76, P0341-00, P000A-00, or P0026-00. There have also been some reports of misfire codes being stored (P03xx).

Cause: The pin on the camshaft sprocket has broken. See attached file for an example.

Action: The issue has been fixed in production at the following VINs:

- Freelander 2 / LR2 - 375956
- Evoque - 840665

A new part number is available: LR050849. These parts have a new pin material and machining changes to the camshaft sprocket body.

