

Reference	SSM72019
Models	Range Rover Evoque / L538
Title	Evoque 2.0GTDI - Low pressure fuel pump
Category	Driveability
Last modified	05-Jan-2015 00:00:00
Symptom	603300 No Start
Content	<u>Issue:</u>

- L538 (Evoque vehicles) equipped with 2.0GTDI engine.
- Vehicle non start or cuts out and will not re-start.
- Low pressure (in tank) Fuel-pump is identified as causal part.

Cause:

- Fuel pumps or vehicles may have been subjected to run dry conditions prior to delivery – Fuel fill during production has now been increased to prevent this.

Action:

- On vehicles up to Vin (H992901) replace the low pressure fuel pump
- On vehicles VIN (H992902 or above) Please replace the fuel pump, and submit an EPQR as engineering may need the part returned for further investigation.