

# TECHNICAL BULLETIN

## LTB00735NAS1

### 18 MAR 2015



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

#### **SECTION: 204-01**

#### **'Knock' Sound From Front Suspension**

#### **AFFECTED VEHICLE RANGE:**

##### **LR4 (LA)**

**Model Year:** 2010 Onwards

**VIN:** AA510742 Onwards

#### **MARKETS:**

NAS

#### **CONDITION SUMMARY:**

**Situation:** A 'knock' sound from the front suspension may be evident when traveling on uneven road surfaces or during low-speed heavy braking.

**Cause:** This may be caused by excessive front suspension lower arm rear bush snubber movement.

**Action:** Should a customer express this concern, follow the Service Instruction outlined below.

#### **PARTS:**

LR067494

Lower arm rear bush

Quantity: 2

#### **TOOLS:**

Refer to Workshop Manual for any required special tools.

#### **WARRANTY:**

 **NOTE:** Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.

 **NOTE:** DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Front lower suspension arm rear bush - Vehicle set - Renew	60.35.36	0.80	42	LR051586

 **NOTE:** Normal Warranty procedures apply.

#### **SERVICE INSTRUCTION:**

-  **NOTE:** both front suspension lower arm rear bushes must be replaced.

Replace the front suspension left and right lower arm rear bush (see TOPIx Workshop Manual, section 204-01).