

TECHNICAL BULLETIN
Q447NAS1
23 MAR 2015



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

SECTION: 418-02

Service Action: Engine MIL Illuminated with DTC P25A2-00 Stored

AFFECTED VEHICLE RANGE:

Range Rover Sport (LW)

Model Year: 2015

VIN: FA504511-FA516326

Engine: V6 S/C 3.0L Petrol

Range Rover Sport (LW)

Model Year: 2015

VIN: FA601763-FA611776

Engine: V6 S/C 3.0L Petrol

Range Rover (LG)

Model Year: 2015

VIN: FA197042-FA212155

Engine: V6 S/C 3.0L Petrol

MARKETS:

NAS

CONDITION SUMMARY:

This Service Action supersedes Update Prior to Sale UPS9814-1b with immediate effect.

Situation: On vehicles fitted with the 3.0L SC V6 engine, the engine Malfunction Indicator Lamp (MIL) may be illuminated with Diagnostic Trouble Code (DTC) P25A2-00 stored in the Engine Control Module (ECM).

Action: Retailers are required to **HOLD** only affected vehicles that are within your control and refrain from releasing to vehicles for new vehicle sale pending completion of the rework action detailed in this Technical Bulletin. Unsold vehicle should have this performed as part of the Pre-Delivery Inspection (PDI) process but **must** have it completed prior to vehicle handover to the customer.

Affected vehicles already in the hands of customers should be updated at the next available opportunity.

PARTS:



NOTE: an initial supply (5 each) of link leads and fusible links have been shipped to retailers at no cost; additional quantities should be ordered as per normal procedures.

DESCRIPTION	PART No. / SUNDRY CODE	QTY. / VALUE	EXPECTED % of VEHICLES REQUIRING PARTS*
Electrical link lead	LR073319	1	100
Fusible link 30amp	LR030045	1	100
Butt splice crimp (1, blue); Heat shrink tubing (2)	ZZZ001	** \$2.89	100