

Reference	SSM72108
Models	LR4 / L319
Title	2015 LR4 Instrument Cluster Message Center Display Concern
Category	Electrical
Last modified	11-Mar-2015 00:00:00
Symptom	204000 Instrumentation
Attachments	1TO Message Center Display Concern.jpg
Content	***UPDATE*** <u>Instrument Cluster software, FH22-14C026-AD was released on DVD139, patch 17, calibration 200 to resolve this concern. This SSM will be removed once a bulletin is released to TOPIx.</u> <u>Model:</u> 2015 LR4 <u>Concern:</u> A customer may state their Terrain Optimisation display in the Instrument Cluster Message Center does not correctly match the actual terrain mode which has been selected. Also the text in the Instrument Cluster Message Center, for the selected terrain mode, does not display correctly. "/BMP_TR_VEHICLE" is displayed instead of the correct corresponding text for the selected terrain mode. <u>Cause:</u> Instrument Cluster software fault for the "<i>English US</i>" language selection. <u>Correction:</u> New Instrument Cluster software is being developed and will be released as soon as possible. A further communication will announce the new software, when it becomes available. As an interim solution, the customer may select "<i>English UK</i>" from the Instrument Cluster display menu as follows: <i>Main Menu > Display Settings > Language</i> Until further notice it is recommended that the UK English language instrument cluster option is selected as a PDI default prior to vehicle delivery and that customers are advised to retain that language option to prevent display concerns. NOTE: When the faulty message is shown, with "<i>English US</i>" selected, the improper display has no effect on the actual Terrain Response system. The Terrain Response switch displays the correct mode. There are no system performance related issues. For further clarification a photo has been attached showing the described concern.

