

Reference	SSM72333
Models	Range Rover / L405
Title	Rear Doors Not Locking or Front Seats Inoperative
Category	Electrical
Last modified	23-Jul-2015 00:00:00
Symptom	203000 Basic Electrical
Attachments	SSM 72333 G3D375 Right Hand Front Seat Crossmember.pdf
Content	<p>Issue: A customer may report any of the following vehicle symptoms:</p> <ol style="list-style-type: none">1. Intermittently the rear doors do not lock when the remote plip button is pressed.2. Drivers seat switchpack inoperative3. Rear doors show open on the Instrument Cluster when they are fully closed.4. Remote central locking inoperative.5. Window switchpack inoperative.6. Interior compartment lights illuminated, when not required. <p>Cause: Possible poor earth connection at ground point G3D375 (See attachment).</p> <p>Action: If any of the above concerns have been reported by the customer, check ground point G3D375 for continuity and security of fastener. If the ground point is not the cause of the concern, then continue with diagnostics using Symptom Driven Diagnostics and with reference to TOPIx Workshop Manual.</p>