# TECHNICAL BULLETIN LTB00817NAS1 29 SEP 2015



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

## SECTION: 501-16

Headlamp Washer Jet Adrift

### AFFECTED VEHICLE RANGE:

LR4 (LA) Model Year: 2015-2016 VIN: 731301-776875 Manufacturing Solihull Plant:

#### MARKETS:

NAS

#### CONDITION SUMMARY:

Situation: The headlamp washer jet(s) may be adrift in the front bumper cover.

Cause: This may be caused by the adhesive not being to specification.

Action: Should a customer express this concern, follow the Service Instruction below.

## PARTS:

NOTE: either adhesive may be used; DP8005 has a lower cure time.

ONOTE: source the adhesive, applicator, and nozzles from a local 3M™ supplier. The applicator and plunger may only be claimed for the first vehicle that is repaired.

NOTE: use the correct size of plunger for the adhesive used.

NOTE: for the adhesive, claim 'ZZZ001', \$25.60.

NOTE: for the applicator, claim 'ZZZ001', \$45.36.

#### NOTE: for the nozzle, claim 'ZZZ001', \$16.20.

DP8005	3M <sup>™</sup> EPX Structural adhesive	Quantity: 1
DP8010	3M™ EPX Structural adhesive	Quantity: 1
-	Two-part adhesive applicator and plunger	Quantity: 1
<u>12</u>	EPX applicator nozzle	Quantity: 1

### <u> TOOLS:</u>

Refer to Workshop Manual for any required special tools.

## WARRANTY:

NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.

ANOTE: DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Headlamp washer jet - Re-installation	84.20.89.26	1.3	D4	LR058562

NOTE: Normal Warranty procedures apply.

## SERVICE INFORMATION:

1Equipment to be used for the bonding of the headlamp washer jet mounting plate to the bumper cover.

- Plunger (1)Applicator (2)
- Adhesive (3)
- Nozzle (4)




E181857

# SERVICE INSTRUCTION:

NOTE: removal steps in this procedure may contain installation details.

NOTE: some variation in the illustrations may occur, but the essential information is always correct.


1Remove the front bumper cover (see TOPIx Workshop Manual, section 501-19).

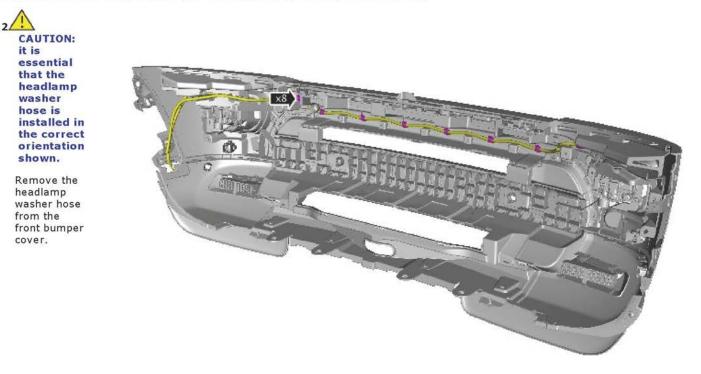

E181648

CAUTION: make sure the locating tangs are aligned. Failure to follow this instruction may result in damage to the vehicle.

> Remove the front bumper cover supporting bracket.

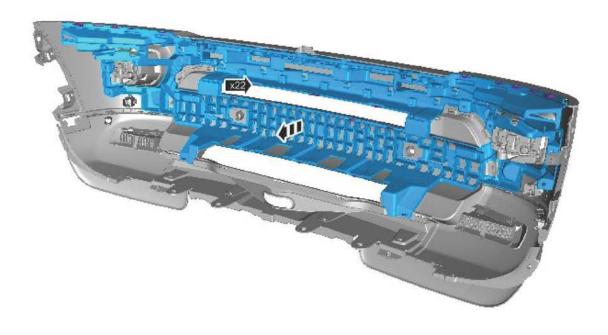


E181649

#### 9/30/2015

#### LTB00817NAS1 - Headlamp Washer Jet Adrift | TOPIx

4Remove the retaining clip from the right-hand headlamp washer jet.


 Remove the right-hand headlamp washer jet from the front bumper cover.

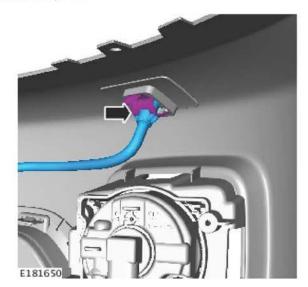

5Remove the right-hand headlamp washer jet mounting plate.



6Remove the adhesive pad from the right-hand headlamp washer jet mounting plate.

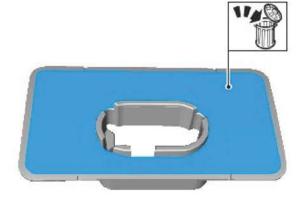

E181652


7 NOTE: using a suitable cleaning agent, clean the area prior to applying the adhesive.

Using a suitable abrasive material, prepare the front bumper cover for bonding.

8 NOTE: ising a suitable cleaning agent, clean the area prior to applying the adhesive.

Using a suitable abrasive material, prepare the right-hand headlamp washer jet mounting plate for bonding.



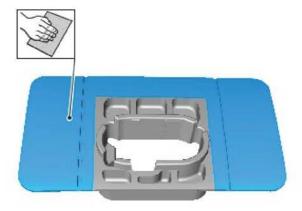


E181654

9 CAUTION: make sure to follow the relevant instructions for the adhesive used in this Step.

CAUTION: make sure that the adhesive is applied as illustrated to avoid excess adhesive being pushed through the hole in the bumper cover when fitting the mounting plate.

Apply a suitable adhesive to the right-hand headlamp washer jet mounting plate.

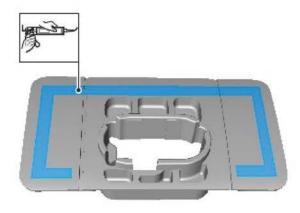


E181655

10 CAUTION: make sure to follow the relevant instructions for the adhesive used in this Step.

Install the headlamp washer jet mounting plate on to the front bumper cover.



11When installing the headlamp washer pipe, align the one-way valve to the bumper wiring harness retaining clip so the hose is not under tension.

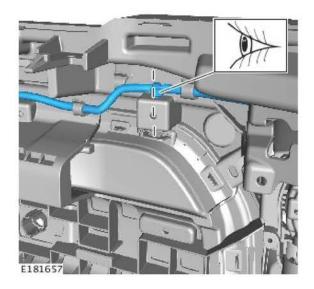

12To install, reverse the removal procedure.