

**TECHNICAL BULLETIN**  
**LTB00823NAS1**  
**28 SEP 2015**



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

Changes are highlighted in gray

**SECTION: 204-00**

**'Creak' Noise From Stabilizer Bar Bushing-Front**

**AFFECTED VEHICLE RANGE:**

**Range Rover Evoque (LV)**

**Model Year:** 2012 Onwards  
**VIN:** 600018 Onwards  
**Manufacturing Plant:** Halewood

**Range Rover Evoque (LV)**

**Model Year:** 2012-2015  
**VIN:** 000447-999999  
**Manufacturing Plant:** Halewood

**Range Rover Evoque (LV)**

**Model Year:** 2015 Onwards  
**VIN:** 000051 Onwards  
**Manufacturing Plant:** Halewood

**MARKETS:**

NAS

**CONDITION SUMMARY:**

**Situation:** A ' creak' noise from the front suspension stabilizer bar bushing(s) may be evident at lower ambient temperatures.

**Cause:** This may be caused by 'stick/slip' between the stabilizer bar bushing and the stabilizer bar.

**Action:** Should a customer express this concern, follow the Service Instruction below.

**PARTS:**

LR079950	Front Stabilizer Bar Bushing	Quantity: 2
FX110056	M10 Hex nut type	Quantity: 2
FY114056	M14 Hex nut type	Quantity: 4

**WARRANTY:**

**NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.**

**NOTE: DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.**

DESCRIPTION	SRO	TIME	CONDITION	CAUSAL
-------------	-----	------	-----------	--------

		(HOURS)	CODE	PART
Bush - Stabilizer bar - Front - Pair - Renew	60.10.05	0.3	41	LR079950


 **NOTE: Normal Warranty procedures apply.**

**SERVICE INSTRUCTION:**

1  **CAUTION: lubricant must NOT be used when installing the new stabilizer bar bushing-front.**

 **NOTE: the new stabilizer bar bushing-front can be identified by a green painted dot in the area shown.**

Install new stabilizer bar bushings-front (see TOPIX Workshop Manual section 204-01).

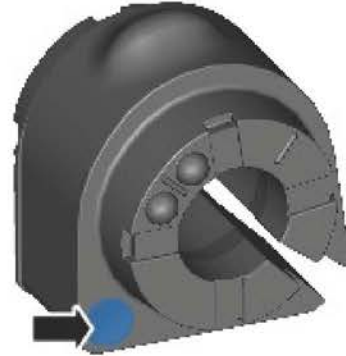

E182199