

Reference	SSM72416
Models	Range Rover Evoque / L538
Title	L538 Hill Start Assist function after configuring the ECM
Category	Driveability
Last modified	08-Sep-2015 00:00:00
Symptom	610000 Buck/Jerk
Content	<p>CONCERN:</p>

After completing 'Q511 - GTDI Pre-ignition' or configuring the Engine Control Module – ECM as existing or new (referred to as the Powertrain Control Module – PCM on SDD) a customer may complain of the Hill Start Assist Function not working correctly.

Affected vehicles:

- 14MY L538 GTDI 2.0L Petrol 856580 - 955856
- 15MY L538 GTDI 2.0L Petrol (NAS) 955857 - 072736
- 15MY L538 GTDI 2.0L Petrol (ROW) 955587 - 074612

CAUSE:

A concern has been identified in the PCM software.

Completing the 'Action' section will install the correct level PCM software to address the Hill Start Assist Function concern.

ACTION:

This workaround will load a software file to SDD using the Manual Patch Update process.

This Manual Patch will stay on the SDD machine until the next SDD software update is installed.

The Manual patch will need to be re-installed after a SDD software update.

1. Select 'Continue' on the SDD Warning screen.
2. Select 'Settings' tab.
3. Select 'System Utilities'.
4. Select 'Manual Patch Update'.
5. A pop-up will be displayed for Manual patch selection dialog box.
6. Enter '**MP_L_K0009**' in the Manual patch selection dialog box.
7. Select 'OK'.
8. The 'Software Management Wizard' will then download the fix file.
9. The Manual patch update information pop up will ask 'Do you want to install the update now?' Select 'OK'.
10. Select 'OK' when the message 'Please shut down SDD before continuing' is displayed. **DO NOT SHUT DOWN THE PC.**
11. 'Please wait' message is displayed.
12. Select 'OK' when the 'Package has been installed' message is displayed.
13. Select 'OK' in the Manual patch update information pop up.
14. Close the Internet Explorer Window where the SDD program runs.
15. Start a new SDD session.
16. Program the **PCM**.
17. On the screen that displays the software summary, the 'Current vehicle information' software will correctly be shown as '! Unknown'.
18. Select 'Tick' when the following message is displayed 'The overall download status of this module cannot be determined due to the unknown status displayed above, make sure the latest software release has been loaded before proceeding'
19. Complete the module programming application.