

Reference	SSM72444
Models	Discovery Sport / L550
Title	Intermittent Operation of Tailgate related Circuits
Category	Electrical
Last modified	30-Sep-2015 00:00:00
Symptom	203000 Basic Electrical
Attachments	G4D4480B Earth Stud.pdf (G4D4480B Earth Stud.pdf)
Content	<u>Issue</u> Intermittent operation of tailgate related circuits • Rear Wiper • Tailgate latch/switch • Powered struts • CHMSL (Centre High Mounted Stop Lamp DAB Radio cuts out when pedal pressed) <u>Cause</u> Potential poor earth stud - G4D480B <u>Action</u> 1. Open tailgate and remove trim for access. 2. Check the earth point shown in the attachment. Check the earth stud for cleanliness and security and ensure it does not spin in the body. 3. If not OK carry out local repair using JLR-MRPK4072 repair tool.

