

TECHNICAL BULLETIN

LTB00382NAS2

05 OCT 2015



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

This reissue replaces all previous versions. Please destroy all previous versions.

Changes are highlighted in gray

SECTION: 501-16

Rear Window Wiper Motor Failure

AFFECTED VEHICLE RANGE:

Range Rover Sport (LS)

Model Year: 2006-2013**VIN:** 900129-814822**Manufacturing Plant:** Solihull

MARKETS:

NAS

CONDITION SUMMARY:

Situation: The rear window wiper motor may be inoperative.**Cause:** This may be caused by internal mechanism components becoming worn.**Action:** Should a customer express this concern follow the Service Instruction below.

PARTS:

LR029319	Rear window wiper motor - 2006-2011MY (VIN 900106-717165)	Quantity: 1
LR029777	Rear window wiper motor - 2012-2013MY (VIN 717166-814822)	Quantity: 1
LR030679	Trim Clip	Quantity: 4

WARRANTY:

 **NOTE:** Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.

 **NOTE:** DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Rear window wiper motor - Renew - 2006-2011MY	84.35.12	0.3	42	DLB500014
Rear window wiper motor - Renew - 2012-2013MY	84.35.12	0.5	42	DLB500014

 **NOTE:** Normal Warranty procedures apply.

SERVICE INSTRUCTION:

1 Verify B+ power to the rear window wiper motor.

- Investigate accordingly as a separate claim.


2 Remove the rear window wiper motor (see TOPIx Workshop Manual section 501-16: Wipers and Washers > Rear Window Wiper Motor).

- Discard the liftgate glass wiper motor trim panel clips.

3 Install a new rear window wiper motor (see TOPIx Workshop Manual section 501-16: Wipers and Washers > Rear Window Wiper Motor), follow Steps 1 - 4 of the install procedure then continue from Step 3 in this bulletin.

4  **NOTE: the liftgate glass wiper motor trim panel retaining clips must be replaced.**

Install the new trim fixing clip (✓) in the location shown.

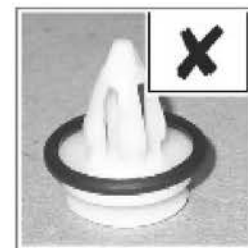

E135062

5 Continue from Step 6 in TOPIx Workshop Manual section 501-16: Wipers and Washers > Rear Window Wiper Motor to complete the install procedure.