

TECHNICAL BULLETIN

LTB00841NAS1
07 OCT 2015



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

SECTION: 417-01

Halogen Headlamp Bulbs

AFFECTED VEHICLE RANGE:

LR2 (LF)

Model Year: 2008-2015
VIN: 000212-439912
Manufacturing Plant: Halewood

Range Rover Evoque (LV)

Model Year: 2012-2016
VIN: 000447-084000
Manufacturing Plant: Halewood

MARKETS:

NAS

CONDITION SUMMARY:

Situation: On vehicles fitted with halogen headlamps, the HB3 halogen bulbs may have blown at low time in service.

Cause: This may lead to earlier than expected bulb replacement.

Action: Should a customer express this concern, follow the Service Instruction below.

PARTS:

LR081691	Resistive cable wire	Quantity: 2
	Cable tie (locally sourced) 100 x 2.5mm	Quantity: 2

TOOLS:

No Tools Required

WARRANTY:

NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.

NOTE: DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Remove for access - Both headlamps - LR2 (L359)	86.40.54	0.1	46	LR058361
Install Resistive cable wire - LR2 (L359)	05.10.10	0.1	46	LR058361
Remove for access - Both headlamps - Range Rover Evoque (L538)	86.40.54	1.4	46	LR058361
Install Resistive cable wire - Range Rover Evoque (L538)	05.10.10	0.1	46	LR024261

NOTE: Normal Warranty procedures apply.

SERVICE INSTRUCTION:

NOTE: the resistive wire **MUST** be fitted to **BOTH** headlamps.

NOTE: the resistive wire **MUST** be fitted **BELOW** the projector unit.