
Reference	SSM72444
Models	Discovery Sport / L550
Title	Intermittent Operation of Tailgate related Circuits
Category	Electrical
Last modified	25-Nov-2015 00:00:00
Symptom	203000 Basic Electrical
Attachments	1G4D4480B Earth Stud.pdf (1G4D4480B Earth Stud.pdf)
Content	<p><u>Issue</u> Intermittent operation of tailgate related circuits</p> <ul style="list-style-type: none">• Rear Wiper intermittent• CHMSL (Centre High Mounted Stop Lamp causing DAB Radio interference when brake pedal is pressed) <p><u>Cause</u> Potential poor earth stud - G4D480B</p> <p><u>Action</u></p> <ol style="list-style-type: none">1. In order to support right first time diagnostics, in the first instance please check the earth stud shown in the attachment. Check the earth stud for cleanliness and security and ensure it does not spin in the body.2. If not OK carry out local repair using JLR-MRPK4072 repair tool.

