
Reference	SSM71812
Models	LR2 / L359 Range Rover Evoque / L538
Title	Turbo bolts insecure: 2.0L GTDI gasoline and 2.2L diesel
Category	Engine
Last modified	07-Dec-2015 00:00:00
Symptom	497000 Engine Noise
Content	<p>Issue: The customer reports an unusual sound coming from the engine area while driving.</p> <p>Cause: Investigations show the bolts that connect the Turbocharger to the downpipe (2.0L GTDI gasoline engines) or turbocharger to manifold (2.2L diesel engines) are insecure or missing.</p> <p>Action: A process issue on the assembly line has resulted in some vehicles leaving the factory with the turbocharger bolts not correctly torqued.</p> <p>If any vehicles are found to have insecure or missing turbocharger bolts refer to TOPIx section 303-04 for the torque values. Please submit an ePQR to report this issue on any vehicles after the following VINs: Freelander 2 - 386451, and Range Rover Evoque - 864783.</p>