

Reference	SSM72569
Models	Discovery Sport / L550 Range Rover Evoque / L538
Title	L550 & L538 16MY 9HP48 9-Speed - An incorrect bolt fitment on GTDI transmission to engine
Category	Driveline
Last modified	22-Dec-2015 00:00:00
Symptom	504000 Other Automatic Transmission Concerns
Attachments	Trans Bolt FS110306 Location.pdf (Trans Bolt FS110306 Location.pdf)

Content**Concern:**

Discovery Sport L550 (LC) 2016MY & Range Rover Evoque L538 (LV) 2016MY fitted with Petrol 2.0L GTDi engine and 9HP48 9-Speed Automatic Transmission:

Transmission supporting bolt incorrectly fitted at the manufacturing plant and under normal operation there is no effect.

When reusing the transmission bolt identified in the attachment, it is possible to strip the sump thread when reinstalling the bolt.

Replacement required when refitting the transmission on the affected VIN ranges below.

- Discovery Sport L550 (LC) 16MY: From H549138 to H558173
- Evoque L538 (LV) 16MY: From H082655 to H091396

Cause:

Incorrect transmission bolt fitted at manufacturing plant.

Action:


Any dealers carrying out any service work when replacing 9HP48 9-Speed Automatic Transmission, or engine replacement or any other service repairs in this area on the above VIN range please discard the transmission bolt as identified in the attachment.

This bolt should be replaced with part number FS110306 and torqued to 48Nm \pm 7.5

See attachment:

- Trans Bolt FS110306 Location

Trans Bolt FS110306 Location

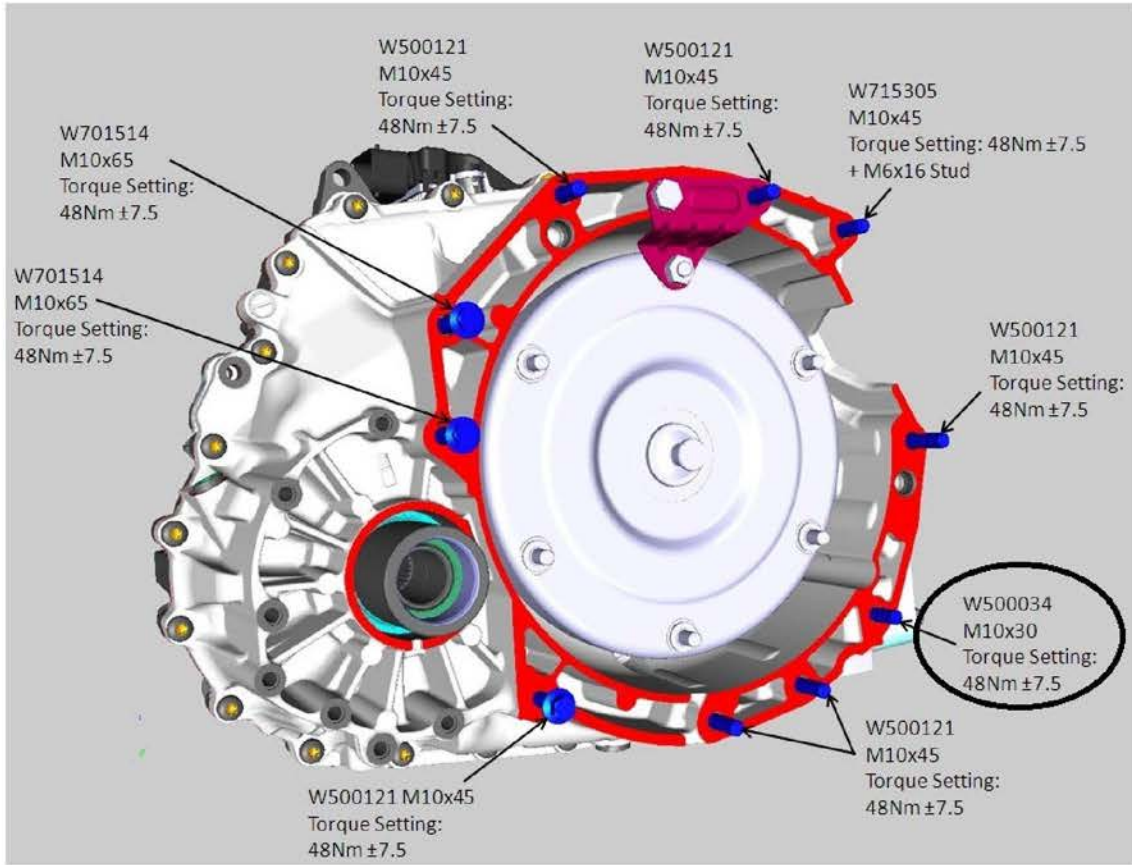

Parts Search | DISCOVERY SPORT (R5) 2015- | R5

[Enter search criteria] Description [Cross catalogue]

Illustration Index

Part Data

General

Callout: HS2
Part number: FS110306
Exchange part:
Description: SCREW
Feature:
Spec. Code: M10 X 30MM, HEXAGONAL HEAD, TRANSMISSION TO ENGINE

Qty:
From:
To:
Notes:

Pricing

Retail: € 2.32
Discount code: 2J
Tax code: 1

3070195

Illustrated Parts - 9 results

Callout	Number	OSI	Description	Feature	Spec. Code	Qty	From	To	Retail	E	Notes
7000	LR070156	Y	TRANSMISSION		REMANUFACTURED	1			€ 5 907.42 + € 1,256.00	E	
7000	LR061646	Y	TRANSMISSION		BEFORE ORDERING PLEASE CHECK FOR SERVICE EXCHANGE VERSION	1		(V)FHS10779	€ 7 372.48 + € 1,256.00	S	
HS2	FS110306		SCREW		M10 X 30MM, HEXAGONAL HEAD, TRANSMISSION TO ENGINE	1			€ 2.32		
HR1	L00746AR		ROSET		M10 X 30MM, HEX R, L/MCP	2			€ 6.66		