

---

**June 23, 2015**02096 Version 1

---

## Safety Recall: 2016 Pilot Third Row Seat Belt Inspection

### AFFECTED VEHICLES

Year	Model	Trim	VIN Range
2016	Pilot	ALL	Check the iN VIN status for eligibility

### BACKGROUND

The third row seat belts are trapped under the third row seat trim.

### CORRECTIVE ACTION

Inspect and, if necessary, release the third row seat belts.

### CUSTOMER NOTIFICATION

Owners of affected vehicles will be sent a notification of this campaign.

Do an iN VIN status inquiry to make sure the vehicle is shown as eligible.

Some vehicles affected by this campaign may be in your used vehicle inventory. These vehicles must be repaired before they are sold.

Should a dealership sell an unrepaired vehicle that subsequently causes an injury or damage because of the recalled item, the dealership will be solely responsible to the damaged party, and will be required to defend and indemnify American Honda for any resulting claims. To see if a vehicle in inventory is affected by this campaign, do a VIN status inquiry before selling it.

**CUSTOMER INFORMATION:** The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Honda automobile dealer.

## WARRANTY CLAIM INFORMATION

Operation Number	Description	Flat Rate Time	Template ID	Failed Part Number
8545A3	Inspect the third row seat belts.	0.2 hr	15-047A	04824-TG7-A00ZB

Operation Number	Description	Flat Rate Time	Template ID	Failed Part Number
8545A3	Inspect the third row seat belts.	0.2 hr	15-047B	04824-TG7-A00ZB
A	Repair the left side third row seat belt.	0.2 hr		

Operation Number	Description	Flat Rate Time	Template ID	Failed Part Number
8545A3	Inspect the third row seat belts.	0.2 hr.	15-047C	04824-TG7-A00ZB
B	Repair the right side third row seat belt.	0.2 hr		

Operation Number	Description	Flat Rate Time	Template ID	Failed Part Number
8545A3	Inspect the third row seat belts.	0.2 hr	15-047D	04824-TG7-A00ZB
A	Repair the left side third row seat belt.	0.2 hr		
B	Repair the right side third row seat belt.	0.2 hr		

Defect Code: 5YS00

Symptom Code: JS700

Skill Level: Repair Technician

## INSPECTION PROCEDURE

**NOTE: The inspection can be done on the service drive.**

Do this inspection by entering the vehicle through the rear passenger door; do not enter the vehicle by opening the rear hatch and do not fold down the third row seats.

Do not use any tools to try and maneuver the belt around the third row seat trim.

The area you will be working in may have sharp metal edges. To prevent injury, wear gloves to protect your hands.

1. Make sure the third row seats are in the upright position. If the third row seat belts are buckled, unbuckle them, and pull them straight up making sure they are fully retracted.



2. Compare the stitching on the seat belt with the edge of the third row side panel arm rest.

- If the seat belt stitching lines up with the edge of the third row arm rest as shown, the seat belt is Good.
- If the seat belt stitching DOES NOT line up with the edge of the third row arm rest, go to step REPAIR PROCEDURE.

GOOD

NO GOOD



SEAM ON  
INTERIOR TRIM

STITCHING ON  
SEAT BELT

SEAM ON  
INTERIOR TRIM

STITCHING ON  
SEAT BELT


## REPAIR PROCEDURE

1. Fold the third row seat down.



THIRD ROW  
SEATS

2. Remove the cargo lid.

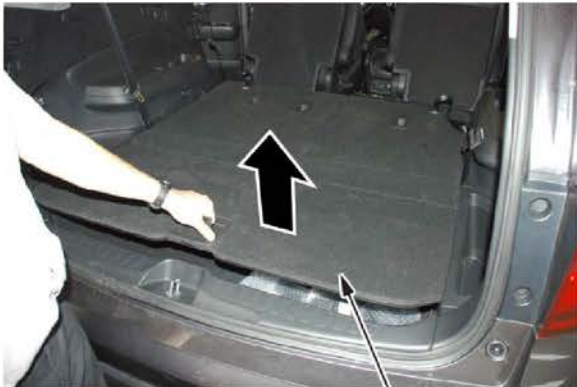

CARGO LID

3. Remove the cargo area trim.




CARGO AREA TRIM

4. While pulling up on the seat belt, maneuver the seat belt from beneath the third row seat side trim to release the belt.

**NO GOOD**

**GOOD**

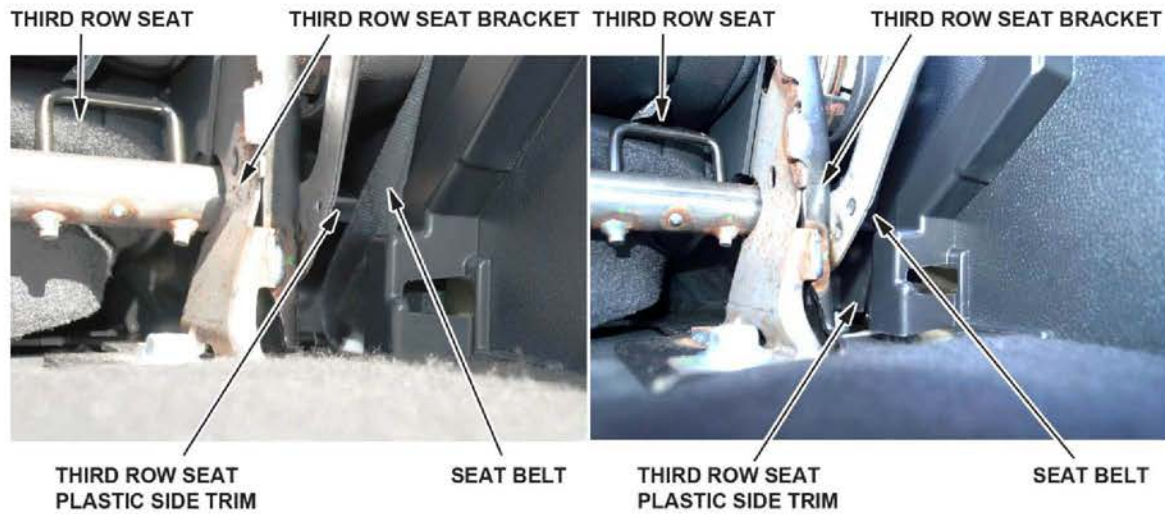

5. Reinstall the parts in the reverse order of removal.