

GPOP - Issue Review System

Part Number: 05033310A\$

Part Description: MAP Sensor

Issue Description: If P2173 PCM fault code is active or stored and customer complains that vehicle goes into limp-in, and ETC and Traction Control lights illuminate after descending a long grade, clear the code. Do not replace any parts. There is an issue with PCM software causing this to occur. New software to address this issue should be available by 4/15/12.

Also, please instruct the driver if this occurs to pull safely out of traffic, place gear selector in Neutral or Park, cycle the ignition key off and then restart the vehicle. This will clear the limp-in condition and ETC and Traction Control lights will go out. Code will also go from active to stored.

If you have any further questions, please contact Tim McDonald, (248) 701-9618.

~ ~
Contact Us at CAGRIS@Chrysler.com for feedback related ONLY to this GPOP Tech Tip. DO NOT email regarding repair procedures unrelated to this Tech Tip or part order inquiries. Please include the Part Number (s) and Tech Tip Part Description of the Tech Tip you are referencing for our tracking system.
