

GPOP - Issue Review System

Part Number: 56054151A\$

Part Description: Park Assist Module and Sensors

Issue For 2010MY DS/DJ/D2 (RAM-1500/RAM-2500/RAM-3500):~

Description: 1)If you are replacing this part(s) because you have an active Diagnostic Trouble Code (DTC) code of U0431 - "Implausible Data Received from the FCC" fault and there is a Wheel Speed Sensor issue, then repair the wheel speed sensor first. This will correct the park assist issue.~

2)If you are replacing this part(s) because you have an active DTC code of B1295-25, B1296-25, B1297-25, and/or B1298-25 - "Signal Shape / Waveform Failure" fault, then check for snow/mud/ice/obstruction and clean the Sensors.~

3) If you are replacing this part(s) because you have an active DTC code of U1101 – "LOC with Rear Display" fault OR if the above issues are not resolved, OR you are replacing these parts for any other reason, please contact Jason Vincent at cell (248) 821-9947. If you do not receive a call back within 15 minutes, then please proceed with the repair, but document all available information for a follow-up call.

~
Contact Us at CAGRIS@Chrysler.com for feedback related ONLY to this GPOP Tech Tip. DO NOT email regarding repair procedures unrelated to this Tech Tip or part order inquiries. Please include the Part Number (s) and Tech Tip Part Description of the Tech Tip you are referencing for our tracking system.
