

45825	<p>Some 2016 F-Super Duty 650/750 vehicles equipped with 6.7L diesel engines may exhibit a condition in which the Stationary Elevated Idle Control (SEIC) is disabled after having successfully entered into Power Take Off (PTO) operation. SEIC disablement can occur after having successfully entered into PTO operation if the vehicle experiences any movement which generates a vehicle speed of greater than 3 miles per hour. To correct the condition reprogram the Anti-Lock Brake System (ABS) module to the latest calibration using Integrated Diagnostic System (IDS) release 100.03 and higher. Make sure you are connected to the internet when entering module programming to obtain the latest updates. Calibration files may also be obtained at <a href="http://www.motorcraft.com">www.motorcraft.com</a>. Use applicable labor operations from Section 2 of the SLTS Manual and causal part 2C219.</p>
-------	---