

	GROUP CLI	MODEL 2014~2015MY Soul (PS)
	NUMBER 030	DATE February 2016
TECHNICAL SERVICE BULLETIN		
SUBJECT: UNEVEN WINDSHIELD DEFROSTER PERFORMANCE		

This bulletin provides the procedure to install vent clips on some 2014~2015MY Soul (PS) vehicles, produced from July 21, 2013 through April 5, 2015, which may exhibit uneven windshield defroster performance. Follow the procedure outlined in this bulletin to install two (2) clips onto the center dash vents to resolve the concern.

Part Name	Figure
Vent Clip (RH)	
Vent Clip (LH)	

File Under: <Climate>


Circulate To: **General Manager** **Service Manager** **Parts Manager**
 Service Advisor(s) **Technician(s)** **Body Shop Manager** **Fleet Repair**

Service Procedure:

1. Locate the mounting locations for the vent clips on the center dash vents, as shown.

 **CAUTION**


Be sure to wear disposable gloves throughout this procedure to avoid soiling interior trim panels.

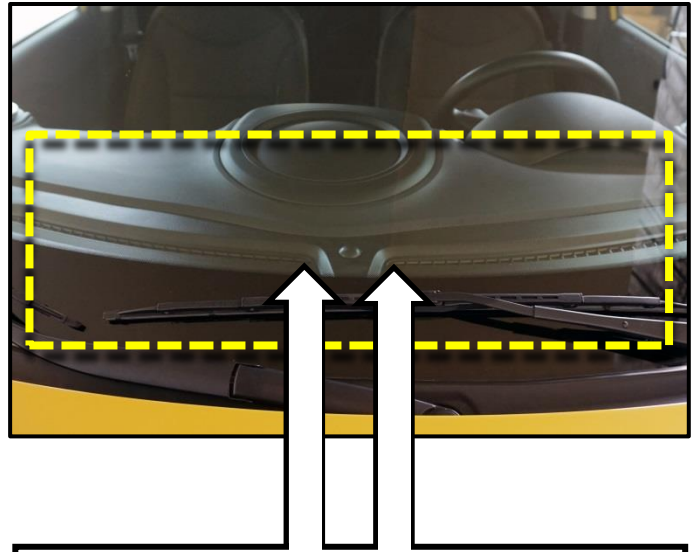

2. Install the left and right vent clips onto the two innermost openings of the dash vents, as shown. **NOTE: dash shown removed to improve illustration clarity only.**

*** NOTICE**

Make sure to avoid dropping the clips into the vents.

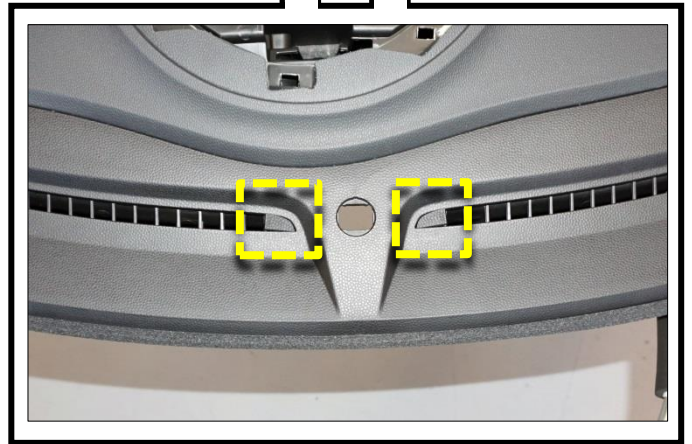

3. Apply downward pressure on each vent clip to secure in place, as shown.





SUBJECT: UNEVEN WINDSHIELD DEFROSTER PERFORMANCE

PRODUCTION DATE:

Model	Production Date Range
Soul (PS)	From July 21, 2013 through April 5, 2015

PART INFORMATION:

Part Name	Part Number	Qty.	Figure
Vent Clip (RH)	84813 B2900FFF	1	
Vent Clip (LH)	84813 B2000FFF	1	

WARRANTY INFORMATION:

Claim Type	Causal P/N	Qty.	N Code	C Code	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
W	84810 B2000EQ	1	I14	ZZ1	(CLI 030) Defroster Vent Clip Install (RH/LH)	84813F00	0.2 M/H	84813 B2900FF and 84813 B2000FFF	1