

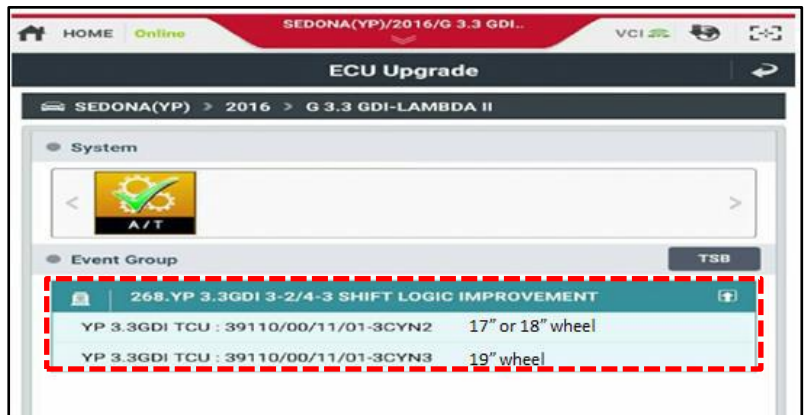
	GROUP Transmission	MODEL 2016MY Sedona (YP)
	NUMBER PS441	DATE February 2016
 		
SUBJECT: HARSH UPSHIFT AFTER PERFORMING TSB TRA 058 / SA208		

KMA has recently identified an increase in Techline cases with a complaint related to “A/T upshifting hard” in most gears. Further investigation has revealed that most of these occurred after performing TSB TRA 058 / SA208 using **Manual Mode** and possibly having, inadvertently, entered an incorrect PCM/TCM part number. In some cases, transaxles have already been replaced without condition improvement. Prior to replacing a transaxle for a similar customer concern, check current ROM ID number using GDS/KDS. NOTE: pay close attention to the wheel size reference information associated with PCM/TCM Part numbers.



If the ROM ID is not correct, reference the ROM ID information table (see below), the PCM/TCM can be corrected by performing another **Manual Mode** reflash. However, please ensure the correct PCM/TCM part number is selected to prevent any further drivability concerns and verify that the correct ROM ID is loaded after the reflash has been completed.

MODEL	SYS	TCM P/N	Wheel Size	ROM ID	
				PREVIOUS	NEW
Sedona (YP) 3.3 GDI A/T	TCM	39110 3CYN2 39111 3CYN2 39100 3CYN2 39101 3CYN2	17” or 18”	TYP0Z33N*****S0	TYP0Z33N*****S1
		39110 3CYN3 39111 3CYN3 39100 3CYN3 39101 3CYN3	19”	TYPAZ33N*****S0	TYPAZ33N*****S1

NOTE: TSB TRA 058 / SA 208 will be updated with additional information