KIN	GROUP Electrical	MODEL 2013MY Soul (AM) 2013MY Sorento (XMa) 2013MY Optima (TF/QF) 2013MY Forte (TD)			
	NUMBER	DATE			
	082 (REV 2, 01/15/2016)	April 2015			
TECHNICAL SERVICE BULLETIN					
SUBJECT: BASE AUDIO SYSTEM UPGRADE					

This bulletin has been revised to include additional information. New/revised sections of this bulletin are indicated by a black bar in the margin area.

This bulletin provides the procedure for upgrading the navigation system and base audio system software of some 2013MY Soul (AM), Optima (TF/QF), Sorento (XMa) and Forte (TD) vehicles, to improve Bluetooth<sup>®</sup> connectivity.



**USB Update Drive** 



GDS - Audio Update Module (AUM)



SUBJECT:

### BASE AUDIO SYSTEM UPGRADE

**Service Procedure:** 

# \* NOTICE

- Delete all paired phones from the system and delete the head unit from all phones. If you do not delete phones, the phone(s) will still show and act as paired, but performance or functionality issues may occur. Anytime a software update is performed to either a paired phone or the system, the pairing should be deleted from both phone and system and then paired again after update.
- A fully charged battery is necessary before audio head unit upgrade can take place. It is recommended that the Midtronics GR8-1299 system be used, in ECM mode, during charging. DO NOT connect any other battery charger to the vehicle during audio head unit upgrade.

# \* NOTICE

- USB drives containing the 13MY Base Audio upgrade were shipped directly to all Kia dealers, and addressed to the Service Manager.
- An AUM update is now available on GDS.



- 1. Start the vehicle or connect the Midtronics GR8-1299 charger.
- 2. Record the customer's radio presets before performing the upgrade.
- If performing the update using the GDS AUM, refer to TSB SST 032 or click on User's Guide > GDS AUM on the GDS main screen, as shown below, and follow the on-screen instructions.

Vehicle RD(UB)2012/3	Technic o		Configuration Search	[
Veniele POUIODIZUIZO	0.4.8.00	Contract Contractions (	orted and	User's Guide User's manual is provided in POF document form, and may take more than 12 seconds at the very first att
	5 1.0 GLA	System > Engine Engine Co	oneo	Overview
Preparation	Diagnosis	Vehicle S/W Management	Repair	O Hardware
Vehicle Info	Basic Inspection	ECU Upgrade	Replacement	ODS Basic Operation
Hot Fix	DTC Analysis	Audio Update	Component Info	ODS Preparation
By DTC	Data Analysis	ID Register	Circuit Diagram	GDS Diagnosis
By Symptom	Case Analysis	Doption Treatment		ODS Vehicle SW Management
By Model	E Flight Record	Data Treatment		Q GDS Repair
By VIN	Oscilloscope	Inspection / Test		Q VMI
	CARB OBD-II	ECU Mapping Verification		User's guide for optional item
				GDS TPMS
Go to > 0				GDS AUM

TSB: ELE 082 (REV 2) Various Models April 2015

#### Page 3 of 7

#### SUBJECT:

### BASE AUDIO SYSTEM UPGRADE

- 4. Turn the head unit ON and wait until booting is finished (approx. 10 seconds) before proceeding to the next step.
- 5. If performing the update using a USB stick, obtain the 13MY Base Audio upgrade USB drive from your Service Manager and insert it in the vehicle's USB port. Make sure to allow for the sound file to play for one second before proceeding to the next step.



Images shown are for demonstration only purposes and will vary by model.

6. Turn the head unit OFF.

**\*** NOTICE

Do NOT turn the vehicle ignition OFF while the update is in progress.



7. Press and hold preset button "1" and then preset button "4" at the same time for five (5) seconds.



#### Page 4 of 7

SUBJECT:

## BASE AUDIO SYSTEM UPGRADE

# **\*** NOTICE

If the software version screen is displayed when pressing and holding the preset buttons 1 and 4, restart the procedure from step 4.



 Immediately after releasing preset buttons "1" and "4", press preset button "1" four (4) times in a row.

## **\*** NOTICE

Do not remove the USB thumb drive, AUM connector or turn the radio OFF while the update is in progress.



9. Check to ensure that the current software version is at or above the information shown in the table below.

Model	Current Version		
Sorento (XMa)	V5.5 and up		
Forte (TD)	V5.5 and up		
Optima (TF/QF)	V5.0 and up		
Soul (AM)	V2.0 and up		

## **\*** NOTICE

If the current software version is lower than the information listed in the table above, open a Techline Case.



#### SUBJECT:

### BASE AUDIO SYSTEM UPGRADE

11. Press button **"1"** to access the Firmware Upgrade Menu.







13. The upgrade will begin and system will display Erasing -> Writing -> Verifying on the screen.



- The update will take approximately three (3) minutes to complete and the system will restart.
- If the system restarts immediately and the power stays off, the update may have failed. Restart the procedure from step 4.



#### Page 6 of 7

#### SUBJECT:

### BASE AUDIO SYSTEM UPGRADE

14. Power up the head unit and repeat steps 6~8 to check the new software version, as shown in the table below.

Model	New Version
Sorento (XMa)	V7.51
Forte (TD)	V8.00
Optima (TF/QF)	V8.00
Soul (AM)	V8.00



- 15. Restore the customer's radio presets as recorded in step 2.
- 16. Verify proper system operation by obtaining the customer's phone(s) and pairing it (them) with the system. If the customer's phone is not available for pairing, inform the customer that the phone must be paired to the head unit.

### **REQUIRED TOOLS:**

Part Name	Description	Figure	Comments
GDS AUM / Upgrade USB Drive	13MY Base Audio Upgrade	Sill	Additional USB sticks can be ordered through Snap-on Equipment Solutions at (888) 542-1011

### AFFECTED VEHICLE PRODUCTION RANGE:

Model	Production Date Range		
Soul (AM)	From May 15, 2012 through January 26, 2013		
Sorento (XMa)	From March 3, 2012 through January 29, 2013		
Optima (TF)	From May 16, 2012 through January 24, 2013		
Optima (QF)	From June 5, 2012 through February 23, 2013		
Forte (TD)	From May 5, 2012 through January 24, 2013		

### STANDARD WARRANTY CLAIM INFORMATION:

#### N CODE: N50 C CODE: C98

Claim Type	Causal P/N	Qty.	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
	96120 2K000		(ELE 082) Base Audio Software Upgrade (AM)				
	96120 2PAA0		(ELE 082) Base Audio Software Upgrade (XMa)				
w	96164 2T000	0	(ELE 082) Base Audio Software Upgrade (QF)	28325F10	0.3 M/H	N/A	0
	96164 2T000		(ELE 082) Base Audio Software Upgrade (TF)				
	96565 1M000		(ELE 082) Base Audio Software Upgrade (TD)				