	GROUP ELE	MODEL 2014~2015MY Sportage (SL)
	NUMBER 092	DATE January 2016
<h2>TECHNICAL SERVICE BULLETIN</h2>		
SUBJECT: SIRIUS AUDIO MUTES (DROPS OUT) INTERMITTENTLY IN OPEN SPACES		

This bulletin provides information about the replacement of the shark-fin style roof antenna of some 2014~2015MY Sportage (SL) vehicles, produced from August 1, 2014 through August 31, 2015, which may exhibit Sirius audio reception concerns (see sample complaints below). Follow the procedure outlined in this bulletin to replace the roof antenna and correct the concern.

Sample complaints include:

- 1- Satellite radio has weak or no signal frequently while driving
- 2- Sirius radio reception cuts in and out often and/or drops out (muting). **NOTE: this condition can occur for time periods longer than 1-2 seconds.**



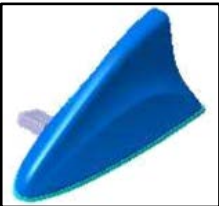
File Under: <Electrical>

-
- Circulate To: General Manager Service Manager Parts Manager
- Service Advisor(s) Technician(s) Body Shop Manager Fleet Repair

SUBJECT**SIRIUS AUDIO MUTES (DROPS OUT) INTERMITTENTLY
IN OPEN SPACES****Service Procedure:**

1. Replace the antenna with an improved one by referring to “Body Electrical System→ Audio→ Antenna→ Repair procedures” chapter in the applicable Workshop Manual.

REQUIRED PARTS:

Part Name	Part Number	Part Color	Figure
Antenna Assembly (Combination)	96210 3W801 9P 96210 3W801 E6S 96210 3W801 UD 96210 3W801 BAH 96210 3W801 A3D 96210 3W801 BEG 96210 3W801 EAB 96210 3W801 D5U	9P (Black Cherry) E6S (Mineral Silver) UD (Clear White) BAH (Vintage Blue) A3D (Bright Silver) BEG (Signal Red) EAB (Sage Green) D5U (Sand Track)	

AFFECTED VEHICLE RANGE:

Model	Production Date Range
Sportage (SL)	From August 1, 2014 through August 31, 2015

WARRANTY INFORMATION:

Claim Type	Causal P/N	Qty.	N Code	C Code	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
W	96210 3W800	1	M64	ZZ3	(ELE 092) Roof Antenna Replace (SL)	96210F00	1.8 M/H	92610 3W801	0