

SSM 45859	<p>Some 2015-2016 MKC vehicles equipped with active park assist may exhibit turn signals, steering wheel radio controls and low speed wipers being inoperative. The stability/traction control indicator lamp may also be illuminated with Diagnostic Trouble Code (DTC) U0131. It may be required to perform the Steering Column Control Module (SCCM) reprogramming function twice to ensure the module is successfully programmed. Reprogram the SCCM with latest calibration using the Integrated Diagnostic System (IDS) release 100.04 or higher. Make sure you are connected to the internet when entering module programming to obtain the latest updates. Use causal part 3F791 and refer to section 10 body/chassis/electrical in the SLTS manual for applicable labor operations.</p>
--------------	--