

SSM 45861	Some 2013-2015 Fusion/MKZs or 2015 Mustangs may exhibit the steering column controls such as turn signals, radio controls, and low speed wipers being intermittently inoperative with a possible U0212 in multiple modules. First, correct any HS2 CAN network issues that may be present if various other HS2 CAN U-codes are present. If no network issue is present and the vehicle is built on or before 3/20/2015, reprogram the Steering Column Control Module (SCCM) to the latest calibration using IDS release 92.01 and higher. Actuate the headlight flash to pass function if the SCCM will not communicate in order to accept the calibration update. Replace the SCCM if communication with the module cannot be restored. Use causal part 3F791 for re-flash only and refer to section 10 body/chassis/electrical in the SLTS manual for applicable labor operations.
--------------	--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------