


Transmission Fluid Pan Leaks

AFFECTED VEHICLES

2016 Accord with CVT

Is the transmission fluid pan leaking from a crack like you see here?

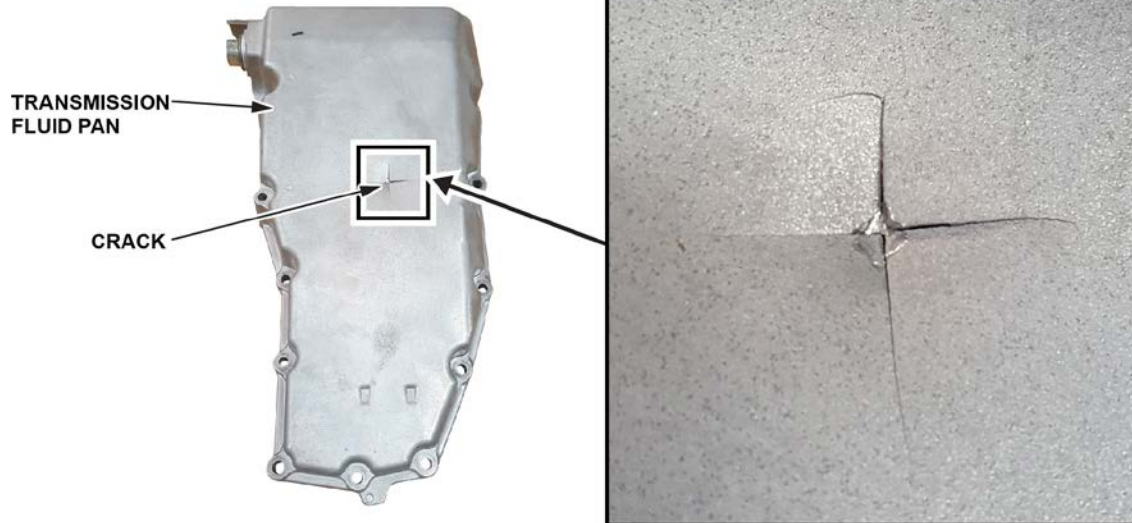

Chances are your customer accidentally ran over something that drove the lower engine cover up into the transmission fluid pan. The cover's front clip, which is made of metal, cracked the pan from the impact.

When replacing the transmission fluid pan, be sure to replace the lower engine cover (P/N 74110-T2F-A01) as well. The replacement lower engine cover eliminates the front hole and clip and replaces the metal clip for the second hole with one made of resin.

Lower Engine Cover - Old



METAL CLIPS (2)

Lower Engine Cover - New



RESIN CLIP