VOLVO CAR SERVICE AND PARTS BUSINESS



Technical Journal

TITLE: Air outlets loose on leather dashboard

REF NO:	ISSUING DEPARTMENT:		ARKET:
TJ 31557.2.0	Technical Service		s and Canada
3 US 7	PARTNER:	ISSUE DATE:	STATUS DATE:
	/510 Volvo Car USA	2016-09-23	2016-09-30
FUNC GROUP: 8811	FUNC DESC: Instrument panel	Page	1 of 10

"Right first time in Time"

Attachment

File Name	File Size
TJ 31557.pdf	2.3519 MB
TJ 31557 pic.pdf	0.0891 MB

Vehicle Type

Туре	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
124							2012-9999		0151101-0999999	201120-999952
136							2012-9999		0118101-0999999	201120-999952

CSC Customer Symptom Codes

Code	Description		
L9	Instrument panel/dashboard/Loose, poor fit, warped, wrinkled		
M9	Instrument panel/dashboard/Tears, snags, cracks		
N7	Instrument panel/dashboard/Other instrument panel/dashboard problems		

VST Operation Number

DTC Diagnostic Trouble Codes

Rows beginning with * are modified

Note! If using a printed copy of this Technical Journal, first check for the latest online version.

Produced in the USA and available as an electronic document. Hard copy documents are printed in USA on recycled paper containing a minimum of 50% wastepaper and 10% post-consumer waste. © 2016 VOLVO CAR USA, LLC



Text

DESCRIPTION:

If the defrost vents on a leather dashboard are loose at the ends (see picture "TJ 31557 pic pdf"), follow the instructions under "Service".

SERVICE:

Fasten the defrost vents with glue according to repair method (see attached).

VEHICLE REPORT:

Yes, please submit a Vehicle Report if the service solution described in this TJ has no effect. Use concern area "Vehicle Report" and sub concern area "Support not needed", use function group 8811.

To view TJ attachment continue to next page. This TJ has two attachments.



Technical Journal 31557.2.0



VOLVO	/olvo Car Customer Service	TJ 3 [,]	1557
Title	Dashboard	Page	1(7)
Action	Product fix	Operation number:	98640-2

Affected vehicles

 Model year
 Model

 2012, 2013,
 S80 (07-)

 2014, 2015,
 2016


 2012, 2013,
 XC70 (08-)


 2014, 2015,
 2016

Materials			
Materials	Qty.	Part No.	Notes
Wurth primer	0.1	089391013	Note: For claiming use Volvo P/N 1161765
Wurth glue	0.1	0893301900	Note: For claiming use Volvo P/N 9511027

Equipment				
Designation	Part No.			
Interior trim remover				
Abrasive cloth				

Removal and Installation

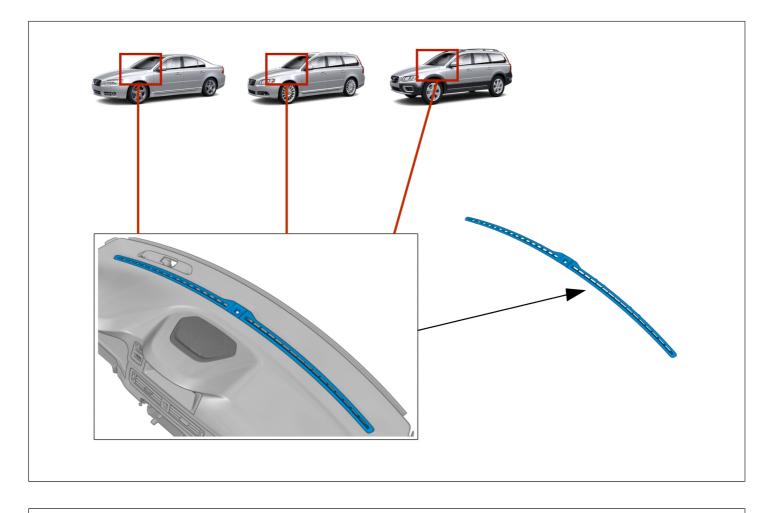


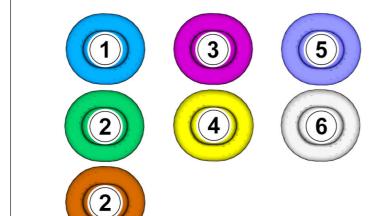



Note! This colour chart displays (in colour print and electronic version) the importance of the different colours used in the images of the method steps.

- 1. Used for focused component, the component with which you will do something.
- 2. Used as extra colors when you need to show or differentiate additional parts.
- 3 . Used for attachments that are to be removed/installed. May be screws, clips, connectors, etc.
- 4 . Used when the component is not fully removed from the vehicle but only hung to the side.
- 5. Used for standard tools and special tools.
- 6 . Used as background color for vehicle components.


TJ 31557

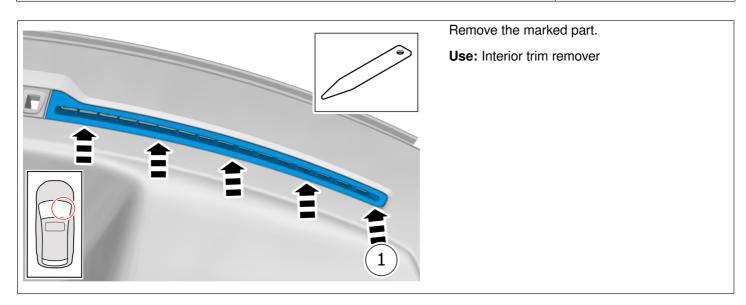


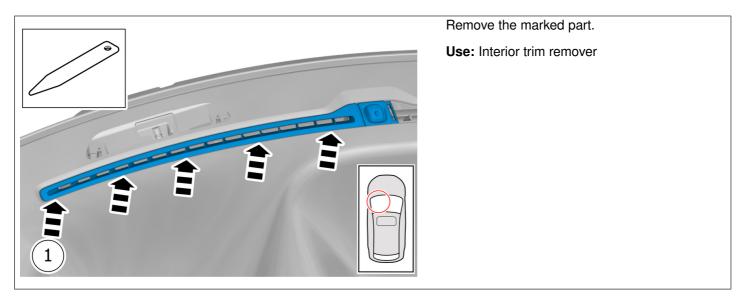


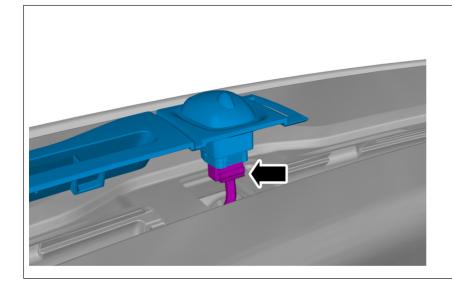



- 1 . Disconnect the connector.
- ² Caution! Secure the wire above the opening using adhesive tape or similar.

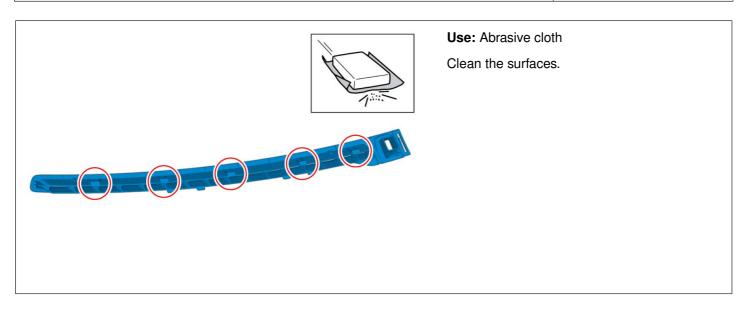


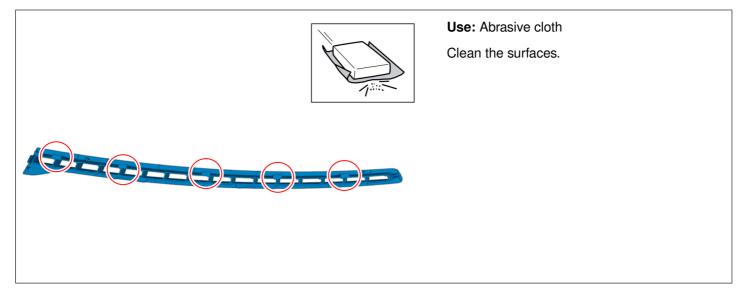

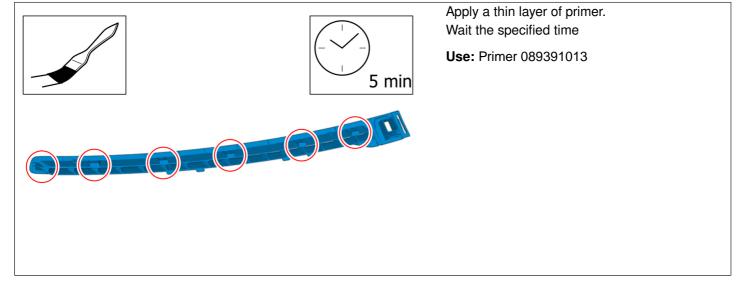

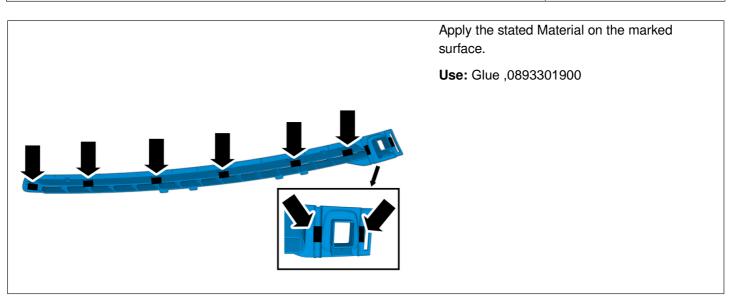


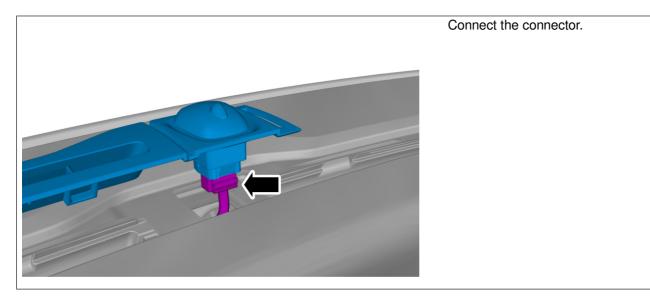

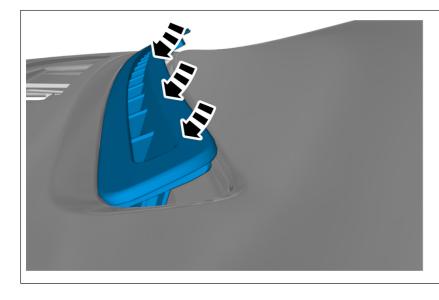

Note! Avoid spillage on visible surfaces. Install the marked component.


TJ 31557

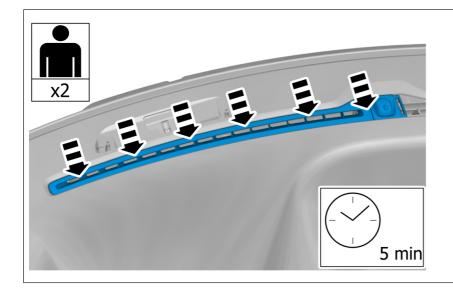


Caution! Make sure that the component is positioned correctly.

Note! This step requires the aid of another technician.


Apply pressure to the joint for the time stated in the graphic.

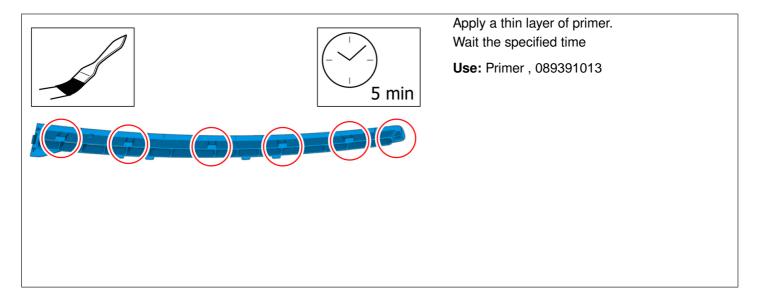

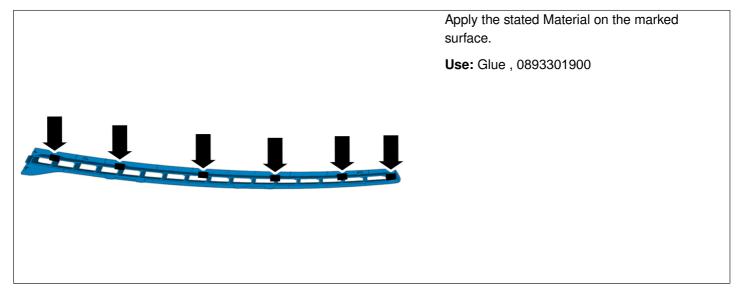

TJ 31557

x2

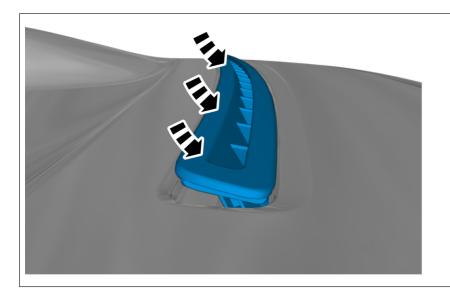

Note! Avoid spillage on visible surfaces.

Install the marked component.

