

SSM 45894	Some 2016 F-Super Duty vehicles built on or before 5/1/2016 may exhibit inoperative remote keyless entry transmitters, power folding mirrors, heating ventilation air conditioning (HVAC) blower motor, and/or no communication with MS-CAN network. If present, check harness under the tire pressure monitor (TPM) module bracket for any wiring concerns. If a wiring concern is found, repair as directed per wiring diagram section 5. Use causal part 15A404 and utilize applicable labor operations from Section 10 of the service labor time standards (SLTS) Manual.
--------------	---