
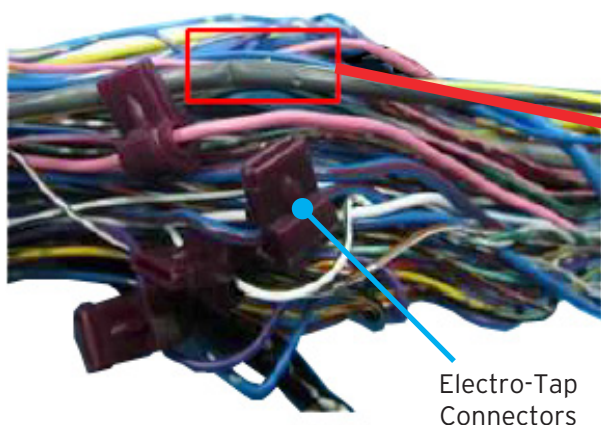


2016 Mazda6 MIL ON WITH DTC P0137

Some customers may complain about a Check Engine Light on with DTC P0137 (HO2S circuit low input) stored in PCM memory. This may be caused by rear harness damage from an aftermarket alarm system installation.

Inspect the rear harness HO2S protector tube near the left kick panel. The HO2S protector tube may be damaged by aftermarket alarm electro-tap connectors. Repair or replace the rear harness as needed.

Lower Dashboard

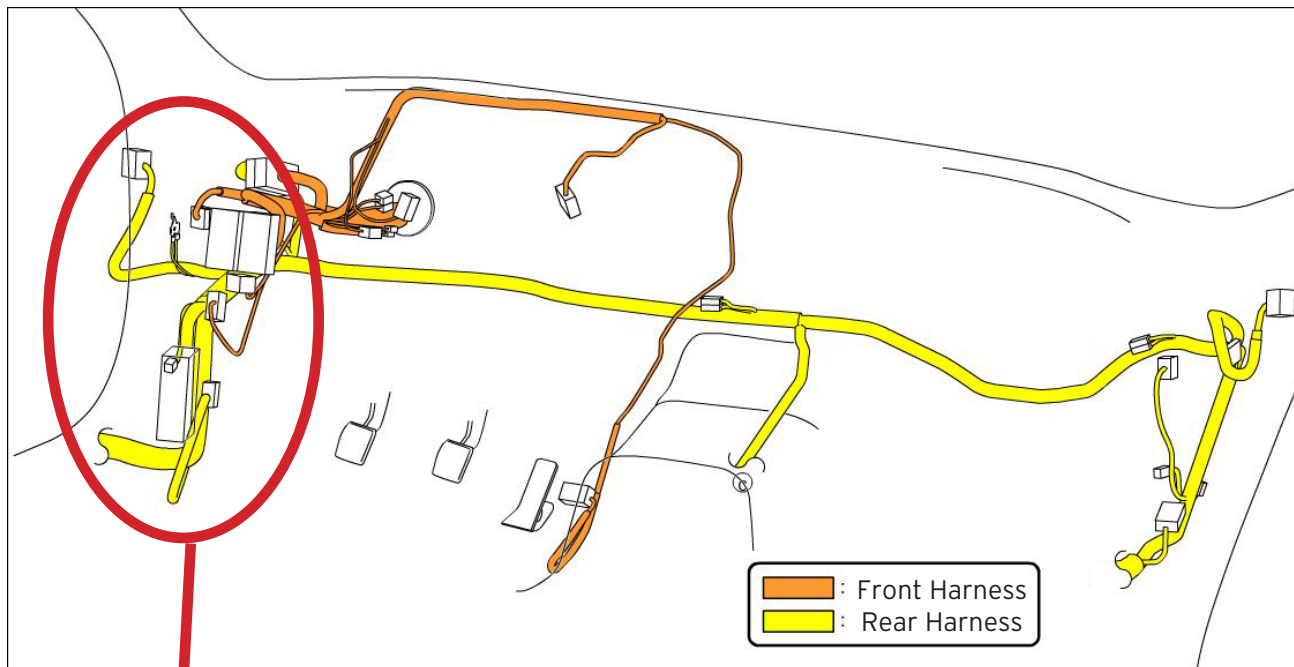

HO2S Protector Tube Damage

Warranty Compliance Note:

Vehicle repairs for this concern are not covered under Mazda's warranty policy.