

2016 CX-9 (EQUIPPED WITH POWER LIFTGATE) *POWER LIFTGATE INOPERATIVE WITH DTC U3003:16*

Some customers may complain about an inoperative power liftgate (PLG). DTC U3003:16 (Power liftgate (PLG) control module power supply voltage low input) is stored in memory. This may be caused by low battery voltage.

Repair Procedure

1. Recharge the vehicle battery.
2. Confirm the lift gate is closed, disconnect the negative battery terminal.
3. Clear the KAM by stepping on the brake pedal and holding high beam on for 1 minute.
4. Reconnect the negative terminal and confirm PLG operation.
5. Clear DTC's.



An editorial board comprised of MNAO service staff members generates, collects, and verifies information for this publication. © 2016 Mazda Motor of America, Inc.

To contribute repair tip ideas, send an e-mail to mtips@mazdausa.com or fax to (949) 442-6599. If we select your repair tip, you will receive \$50 value in Reward Performance by Mazda (RPM) points for your efforts. All contributions become property of MNAO, which assumes permission to publish them without further consideration.