


2010-2013 Mazda3

 
CONNECTOR 0918-501 AND 0920-403 SERVICE CAUTION


 
When performing electrical repairs on the instrument panel harness (e.g. 2010 MAZDA3 DASHBOARD UPPER PANEL STICKY SURFACE SSP99), take caution when re-connecting connectors 0918-501 and 0920-403. Both connectors are identical and near the same location. If connected incorrectly, multiple electrical malfunctions will occur (e.g. hazard lights stay on).


0920-403
Microphone

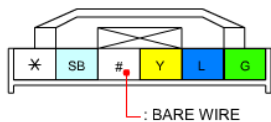

0918-501
Hazard Warning Switch



 : Instrument Panel Harness
 : Instrument Panel No. 2 Harness

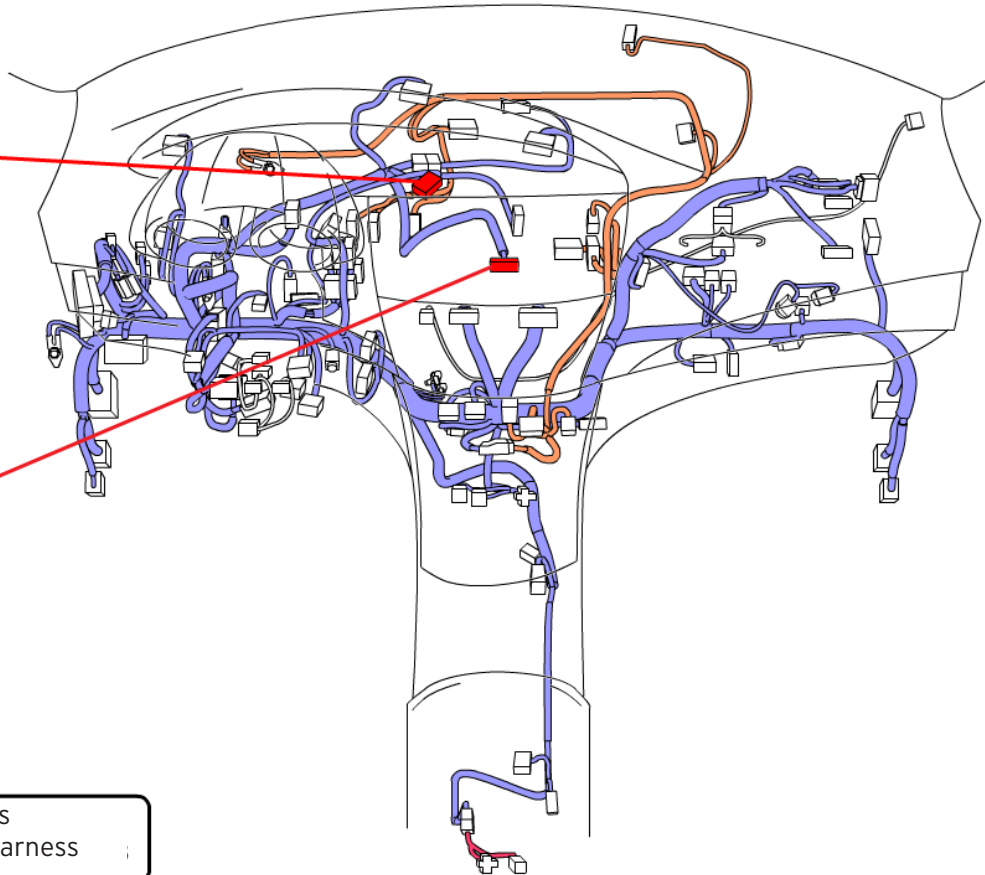

An editorial board comprised of MNAO service staff members generates, collects, and verifies information for this publication. © 2016 Mazda Motor of America, Inc.

To contribute repair tip ideas, send an e-mail to mtips@mazdausa.com or fax to (949) 442-6599. If we select your repair tip, you will receive \$50 value in Reward Performance by Mazda (RPM) points for your efforts. All contributions become property of MNAO, which assumes permission to publish them without further consideration.