	<b>Warranty Bulletin</b> 2016-14	<b>Issued Date</b> June 22, 2016
	<b>Subject</b> Sorento Driver's Front Airbag Clock Spring Assembly 2011-2015 MY	

This bulletin provides information related to the replacement of the driver's front airbag clock spring assembly on the **2011-2015 MY Sorento** vehicles, manufactured from 10/24/2009 through 12/17/2014. The clock spring is an electrical connection which rotates with the steering wheel to maintain proper functioning of the airbag unit. Kia's system is designed to illuminate the airbag warning light when electrical resistance increases, which can be contributed to by usage patterns and environmental conditions. Illumination of the airbag warning light advises the driver to have the system inspected and repaired. If continued to be used without repair, the driver's airbag may eventually not deploy in a frontal impact.

Kia is extending the warranty coverage for the driver's front airbag clock spring assembly on the **2011-2015 MY Sorento** vehicles, manufactured from 10/24/2009 through 12/17/2014, to **fifteen (15) years with unlimited mileage**, starting from the date of first service. This warranty extension addresses failures of the driver's front airbag clock spring as reported by some vehicle owners, as well as the diagnosis of any concerns related to the airbag warning light.

**Please note this is not a service campaign that requires mandatory repair for all eligible vehicles. The driver's front airbag clock spring assembly should only be replaced under this warranty extension program when the airbag warning light is illuminated due to clock spring concerns or issues.**


**Required Parts:**

Model	Old Part Number	New Part Number
XMa	93490-1U480	93490-1U125FFF
	93490-1U480CA	
	93490-1U180	
	93490-1U380	93490-1U325FFF
XMa F/L	93490-1U120	93490-1U125FFF
	93490-1U320	93490-1U325FFF

**WARRANTY CLAIM INFORMATION:**

Air Bag Warning Light On


Claim Type	Causal P/N	Qty	N Code	C Code	Repair Description	Labor Op Code	Time	Replacement P/N	Qty
W	93490-1U125FFF OR 93490-1U325FFF (Heated Steering Wheel)	1	I3R	ZZ3	Clock Spring Assy Replacement	Primary Labor Op: 93490F01	0.4	N/A	0
	GDS Operation Clock Spring				Add: 93490RQ0	0.3			

	<b>Warranty Bulletin</b> 2016-14	<b>Issued Date</b> June 22, 2016
	<b>Subject</b> Sorento Driver's Front Airbag Clock Spring Assembly 2011-2015 MY	

Airbag Illumination Diagnosis Only (No Clock Spring Assy. Replacement):

Claim Type	Causal P/N	Qty	N Code	C Code	Repair Description	Labor Op Code	Time	Replacement P/N	Qty
W	93490-1U125FFF OR 93490-1U325FFF (Heated Steering Wheel)	0	I3R	ZZ3	GDS Operation Clock Spring	93490RQ0	0.3	N/A	0

Required Tools:

Part Name	Part Number	Qty		Comments
Generic Steering Wheel Puller	N/A	1		Locally Sourced