

Reference	SSM72921
Models	F-PACE / X761 XE / X760 XF / X260
Title	Engine Malfunction Indicator (MIL) Illuminated - DTC P025C-11 (PCM)
Category	Engine
Last modified	05-Aug-2016 00:00:00
Symptom	499000 Basic Engine

Content **Issue:** A Customer may express a concern that the Malfunction Indicator Lamp (MIL) is illuminated with Diagnostic Trouble Code (DTC) P025C-11 set within the PCM

Cause: False setting of P025C-11 DTC

Action:

1. Restart the SDD machine
2. Login to SDD.
3. Select 'Continue' on the SDD Warning screen.
4. Select 'Settings' tab.
5. Select 'System Utilities'.
6. Select 'Manual Patch Update'.
7. A pop-up will be displayed for Manual patch selection dialog box.
8. Enter '**MP_JLR_L0025**' in the Manual patch selection dialog box.
9. Select 'OK'.
10. The 'Software Management Wizard' will then download the fix file.
11. The Manual patch update information pop up will ask 'Do you want to install the update now?' Select 'OK'.
12. Select 'OK' when the message 'Please shut down SDD before continuing' is displayed. **DO NOT SHUT DOWN THE PC.**
13. 'Please wait' message is displayed.
14. Select 'OK' when the 'Package has been installed' message is displayed.
15. Select 'OK' in the Manual patch update information pop up.
16. Close the Internet Explorer Window where the SDD program runs.
17. Start a new SDD session.
18. Program the '**Powertrain Control Module**' (PCM).
19. Close the SDD session.
20. Restart the SDD machine.

Please Note - This SSM will be replaced with a TSB when DVD146 Patch 7 is launched on the 25/8/2016