



# Service Bulletin

## PRELIMINARY INFORMATION

**Subject:** Diagnostic Tip - Battery Discharged Overnight

**Models:** 2015-2016 Chevrolet Colorado  
2015-2016 GMC Canyon


The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

### Condition/Concern

The customer may state that the battery is discharged overnight. The technician may duplicate a 150mA to 450mA draw.

### Recommendation/Instructions

Inspect X301 (Headliner to Body Harness near the CHMSL) for bent pins as shown below. Repair or replace terminals as needed.

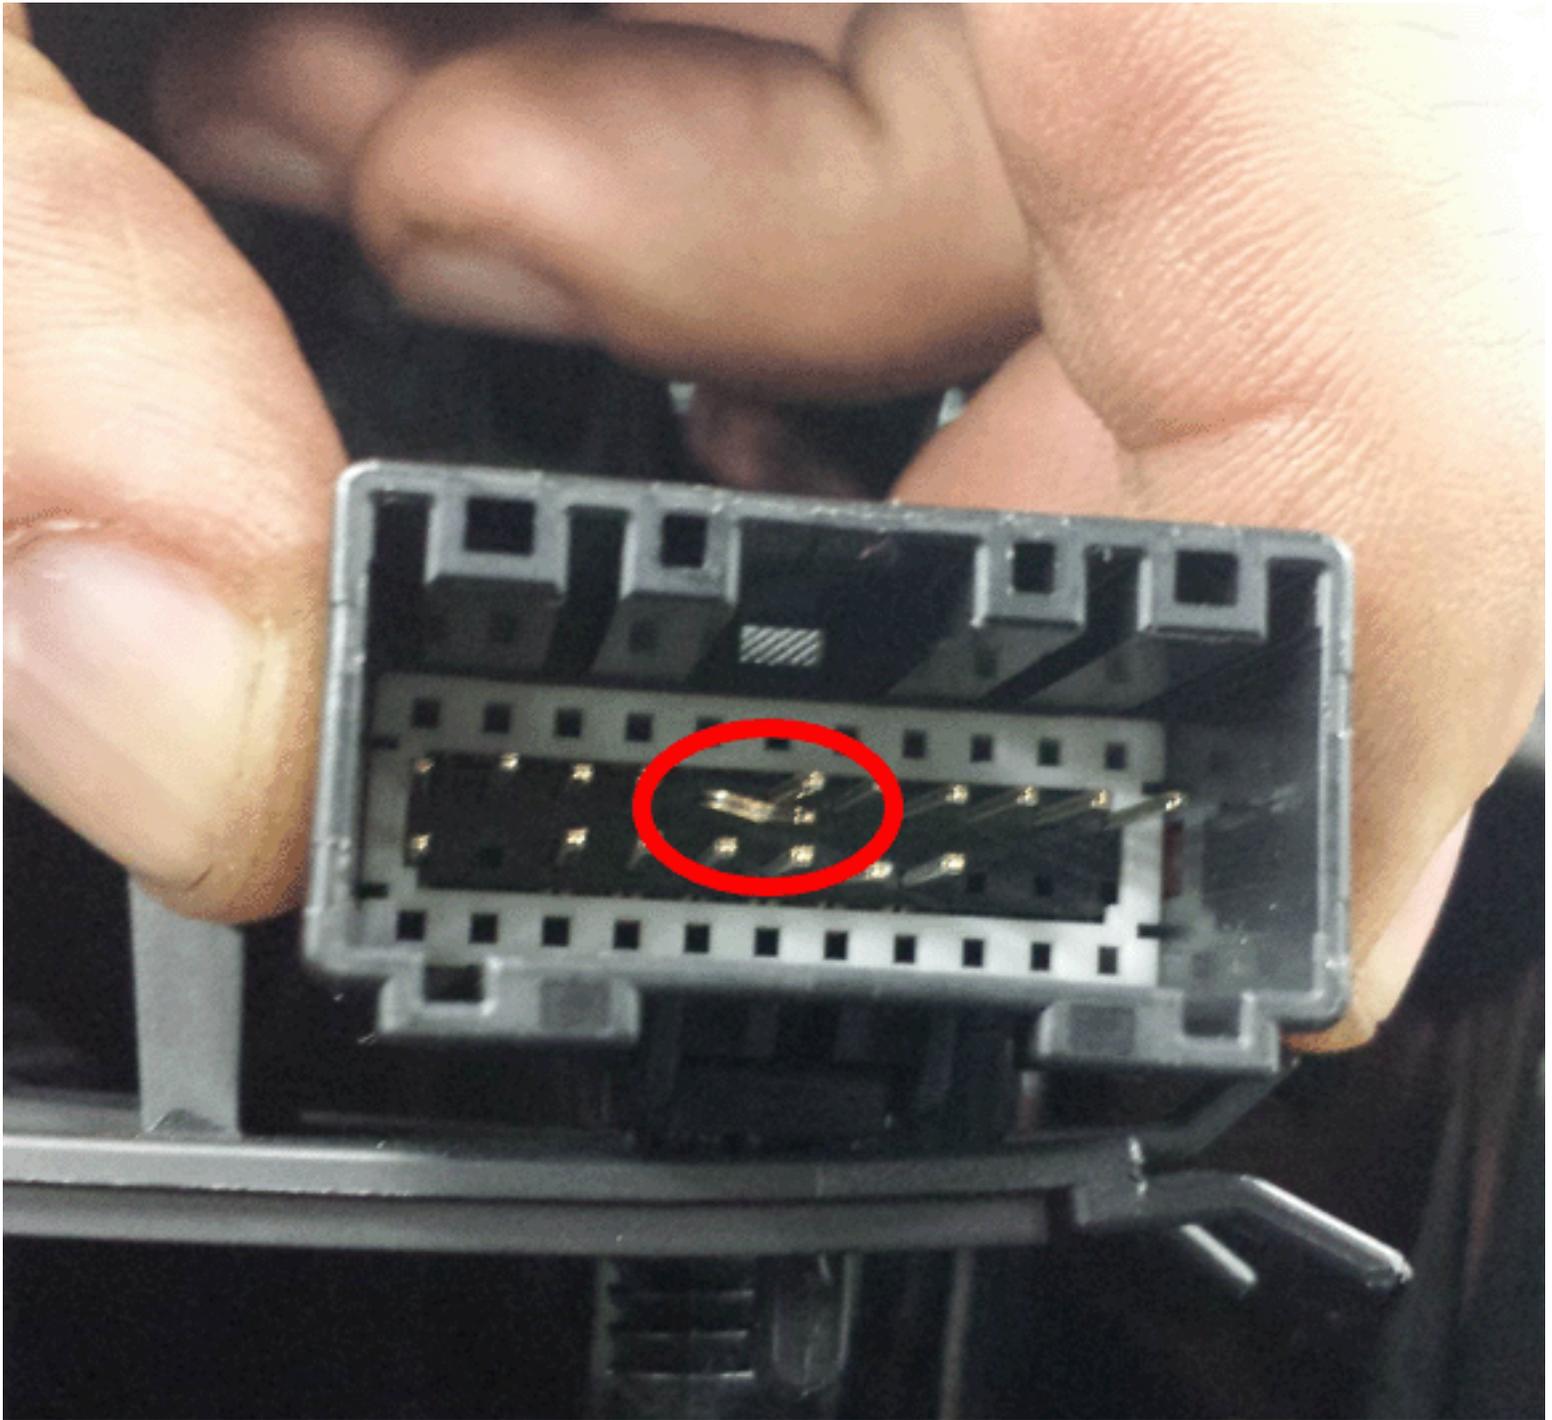

## Warranty Information

For wiring repairs covered under warranty, please refer to latest version of bulletin 10-00-89-005 for warranty information on wire/connector repairs.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

---

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION