



Service Bulletin

PRELIMINARY INFORMATION

Subject: Engine May Shut Off After Wide Open throttle Maneuvers SES Lamp Setting P0121 P02101 And P2119

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	CTS-V	2016	2017	SOP	END	6.2 LT4	All

Involved Region or Country	North America
Additional RPO/s:	N/A
Condition	A vehicle may have a concern where the Engine may shut off after Wide Open throttle maneuvers, and SES lamp with a P0121, P2101 and P2119
Cause	Customer driving vehicle aggressively on track like conditions (quick WOT to 6000 rpm's 2nd gear, quickly followed by no throttle: on ramp acceleration and quick back-off into traffic). May experience engine cutoff and set DTCs P0121-00, P2101-00 and P2119-00 accompanied by engine shut down. Vehicle will re-start.

Correction

Do not replace ECM, Throttle Body or other components. Request customer not operate vehicle in this manner, engineering working on fix to address this issue.

Version	1
Modified	

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION