



Tech Tips

TT 40-16-01

Date: June 2, 2016

2014-2016 CC – Knocking Noise from Vehicle Front, Typically occurs only one time after each direction change (forward or backward, left or right)

June 24, 2016: Update to Information and Model Year Applicability.

If this concern is identified, inspect to see if the two specialty plates (washers), Part No: 7M3499349A, are installed between the sub frame and body. If not, please perform the following:



- Loosen by two turns, the four bolts towards the rear of the sub frame.
- Remove one inboard bolt.

Service Information



- Insert washer Part No. 7M3499349A between sub frame and body, centered on the hole with tabs of washer pointing rear and down as shown.
- Insert a new bolt and hand tighten.
- Repeat the above procedure with second inboard bolt.
- Tighten all 4 bolts, in accordance to Repair Manual Group 40 Front suspension, driveshaft in Elsa.

 Note:

Sub frame bolts and specialty plates (washers) **MUST** be replaced after every removal.