



Tech Tips

TT 96-15-02

Date: February 27, 2015

2013-2017 Tiguan-Alarm Horn Tone Weak or Abnormal When Locking

June 10, 2016: Update to Model Year Applicability.

Before replacing the alarm horn (part number 5C0951115) for a weak, muffled, or abnormal tone condition, ensure that the alarm horn bracket mounting nut is securely fastened to the vehicle body (number 3 in the illustration below) with the proper torque specification. According to the Elsa Repair Manual, the specified torque for the securing nut is 20 Nm.

