



Tech Tips

TT 01-15-06

Date: October 23, 2016

2015-2016 Jetta, Golf, Passat – 09G Gen 3, Erratic Shifting, P1624/P0776/P0796. Harsh Upshifts

Update to Model Year Applicability: April 22, 2016.

Faults may be caused by a broken wire at Pin 6 of the T8 connector located under the starter (for the N216/ N217 Solenoids.) Inspect the connector for a loose or broken Lilac/Yellow wire. Repair as needed, clear the DTC's and perform Basic settings. Perform a 25 mile drive to facilitate the complete relearn of basic settings prior to re-assessing for any additional transmission concerns.

