

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Jetta	2015-2016	1.8T (CPKA, CPRA) 2.0L TDI (CVCA)	All	All	All

Condition

01 16 05 April 25, 2016 2043736 Supersedes Technical Bulletin V011604 dated April 8, 2016 to remove CJAA engine code applicability.

MIL ON, DTC P05A3 and/or P05A0 Active Radiator Shutter Grille faults stored in ECM Fault Memory

Customer states the MIL light is on, DTC P05A3 and/or P05A0 in the ECM.

DTC	Description	
P05A3	Active Grille Air Shutter "A" Control Circuit Range/Performance	
P05A0	Active Grille Air Shutter "A" Stuck On	

Technical Background

Fault code being stored in the ECM due to the incorrect software within the motor of the Active Radiator Grille.

Production Solution

Updated Active Radiator Grille part number 95B 965 501 H.

© 2016 Volkswagen Group of America, Inc.



Service

Inspect the Active Radiator Grille motor part number (located on the motor itself, see Figure 1) and perform one of the two following steps.

Note:

To access the grill motor information, remove the noise insulation (lower engine shield) from beneath the car and the motor will be located in the center of the lower air intake of the bumper.

- If part number is less than 95B 965 501 H, similar to the picture below, the motor/grille will need to be replaced.
- If part number is 95B 965 501 H or higher, the motor/grille is OK and normal Guided Fault Finding diagnosis
 must be performed. <u>This technical bulletin does not apply</u>.



Figure 1

If the Active Radiator Grille needs to be replaced, follow the steps outlined in ELSA to replace the Active Radiator Grille.

© 2016 Volkswagen Group of America, Inc.



Warranty

To determine if this procedure is covered under Warranty, always refer to the Warranty Policies and Procedures Manual ¹⁾							
Model(s)	Year(s)		Eng. Code(s)	Trans. Code(s)	VIN Range From		VIN Range To
Jetta	2015-2016		1.8T (CPKA, CPRA) 2.0 TDI (CJAA, CVCA)	AII	All		AII
	SAGA Coding						
Claim Type:		Use appl	icable Claim Type	1)	10		
Service Number:			Damage Code	HST		Damage Location (Depends on Service No.)	
1932			0040			Use applicable when indicated in Elsa (L/R)	
Parts Manufacturer		Jetta		3ME ²⁾			
Labor Operation ³⁾ : Charge Battery			27068950 = 10 TU				
Labor Operation ³⁾ : Remove and Install Noise Insulation (Lower engine shield)			Gasoline: 10821900 = 30 TU Diesel: 10821903 = 40 TU				
Labor Operation ³⁾ : Remove and Install Front bumper			63291900 = 60 TU				
Labor Operation ³⁾ : Remove and Install Radiator Shutter			19321950 = 10 TU				
Causal Part:			5C6122321				
Diagnostic Time ⁴⁾							
GFF Time expenditure 01500000 = 20 T			01500000 = 20 TU	max.		YE	ES

© 2016 Volkswagen Group of America, Inc.

Page 3 of 4



Road Test	01210002 = 00 TU 01210004 = 10 TU	YES
Technical Diagnosis	01320000 = 00 TU max.	NO
El contra de la co	ny Warranty in which case this Technical Bul	letin is informational only
²⁾ Code per warranty vendo	r code policy.	letin is informational only
 ²⁾ Code per warranty vendor ³⁾ Labor Time Units (TUs) ar 		

Required Parts and Tools

Part Description	Part Number
Active Radiator Grille	95B965501H

Tool Description	Tool No:
Midtronics Battery Tester/Charger	InCharge 940 (INC-940)
	or
	GRX3000VAS
VAS Diagnostic Tool	VAS 6150/X & VAS 6160/X with:
	ODIS Service with current online updates
Trim Removal Wedge	3409
Pry Lever	80-200

Additional Information

All part and service references provided in this Technical Bulletin are subject to change and/or removal. Always check with your Parts Dept. and Repair Manuals for the latest information.

© 2016 Volkswagen Group of America, Inc.