## **Tech Tips**

### TT 91-16-09

#### Date: May 20, 2016

### 2015 Golf, GTI, Golf R, Sportwagen, eGolf – MIB1, 2016 Golf, GTI, Golf R, Sportwagen, eGolf, Passat, Jetta, CC, Tiguan, Beetle, Beetle Convertible – MIB2 - B201A Fault Stored in MIB2 Infotainment System

After replacing or updating a J794 – MIB2 Infotainment module, a "B201A: Checking software version management" fault may store. To erase this fault, perform the following:

Offboard Diag	gnostic Information System Service - 3.0.3				-C2+ ( -C1+	<b>B</b>
Importer: Dealer: RO:	444 03100 	VIN: Engine:	3VWC17AU9GM511912 all engine identifier codes	🥔 🛃 🍫 0		)
Control mode	ules Orders DISS TSB Test pla	n Operation Special Functions			Operating mode	es *
Tests for the	entire vehicle				👽 Diagnosis	
Status	Tests				🗯 OBD	
-	0025 - Online system te	st			E FINIS	_
	0025 - XCP Debug				OManagement	
	0025 - Component protection fu	inctions			in measureme	FIR
	0025 - Showroom mod	a)			lnfo	
-	KS-Master (Gateway) o	onnection system			Admin	
	005F - Information electronics of	ontrol module 1   J794			Log	×
-	005F - Design status ch	eck/reset DTC memory			Data	¥
	Software version management					
	Adapt software (offline)				Extras	¥
-	Adapting software				Help	×
-	Code online control mo	dule "			Info	×
Perform tes	L. Display documents				>	3
	Windows Explorer			Read control modules agai	6	

Under the Special Functions tab, run the "005F-Design status check/reset DTC memory" test plan.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



# **Service Information**

When the test plan reaches the step to "restart the Main-Unit via the Touch-Screen-Monitor, hold the radio's power button down for 10 seconds to reboot the J794. Once the radio turns back on, select Complete/Continue.

Offboard Diagnostic	Information System Service - 3.0.3					- (See	- 6 -
Importer: Dealer: RO:	444 03100	VIN: Engine:	3VWC17AL all engine id	9GM511912 entifier codes	🧈 🛃 🍉 8		
Reset BZD/FSP NOTE:   - Please restart the Main-Unit via the Touch-Screen-Monitor.						Operating mo	odes *
NOTE: • The "restart" of • If no update h	only appears on the touchso as been performed, no rest	reen monitor if the main unit was art of the Main Unit is not necessa	updated via a data carrier i ry.	n advance.		Measurer	ment
						Data	*
						Help	*
	K	< > >	Help	* Cancel test		Info	×
					Test version		-

Once the test plan ends, the B201A fault should clear.

© 2016 Volkswagen Group of America, Inc.

all rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.