



Technical Bulletin

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
e-Golf	2015	All	All	All	All

Condition

91 16 05 August 9, 2016 **2040330** Supersedes Technical Bulletin V911504 dated April 29, 2015 to update software level.

Modular Infotainment System (MIB) Display Shows Fuel Pump Icon after J794 Module Replacement

The customer may complain that after a repair involving replacement of the 5F Information Electronics Module J794, that the icon in the lower right hand side of the "Car" menu on the MIB display shows the image of a fuel pump instead of an electric charging station icon.



Note:

This technical bulletin must be read in its entirety before attempting the software update.



Technical Bulletin

Technical Background

This procedure corrects the concern listed above by updating the 5F Information Electronics Module to software **E5140**.



Tip:

This programming software is obtainable via ServiceNet.

Production Solution

Not applicable.

Service

Software Update Procedure


- Connect Midtronics InCharge 940 (INC 940) or GRX3000VAS Tester/Charger to the vehicle's 12 volt battery.
- Switch the ignition to the ON position.
- Switch ON the MIB radio.
- Press and hold the "Menu" button on the right side of the MIB display controls to enter Service Mode.
- Insert the software update SD card into the 5F module SD card reader located in the glove box.



- Select "Software download/logging" on the touch screen menu.



Technical Bulletin

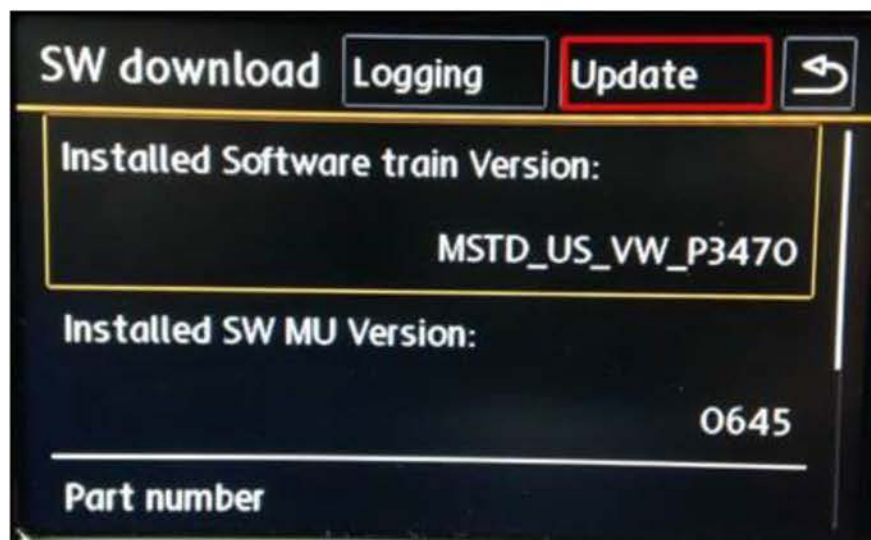


- Press "Update" on the touch screen menu.




- Press "SD card" on the touch screen menu to select SD card as the source.



Technical Bulletin

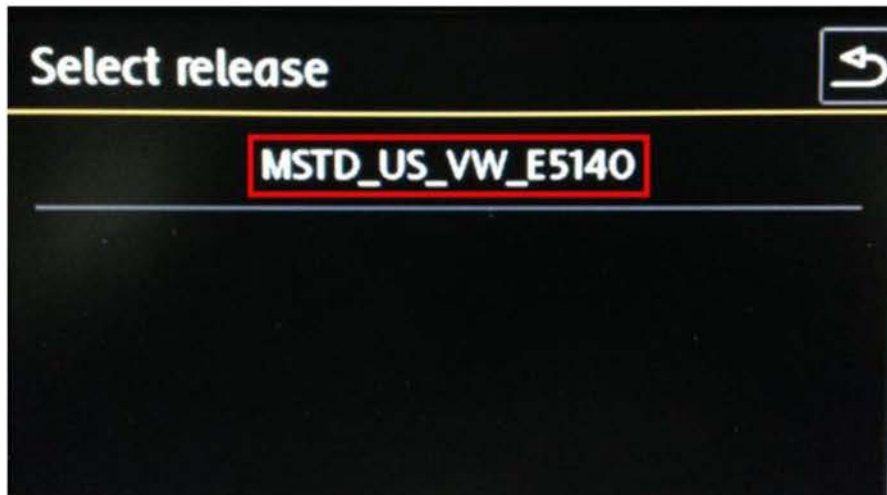

- Press "MSTD_US_VW_E5140" on the touch screen menu.

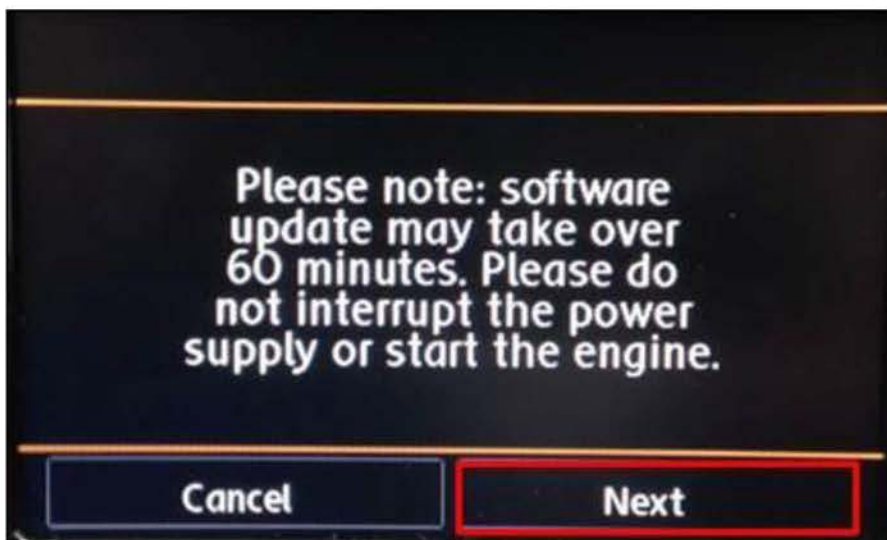

- Press "Next" on the touch screen menu.
- The update will now take place.




Tip:

The system may reboot one or more times during the update process. This is normal and not indicative of a malfunction.



Technical Bulletin

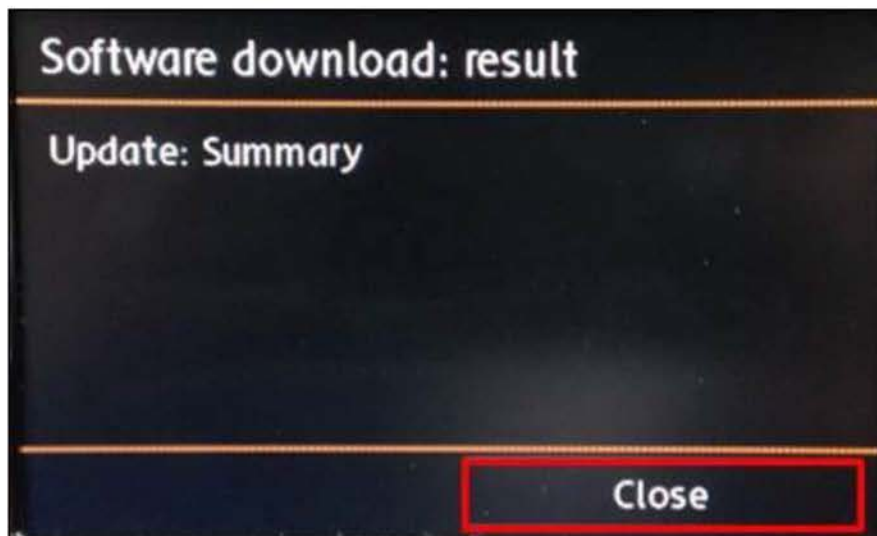

- Once the software update is complete, press “close” on the touch screen menu.



Technical Bulletin

Warranty

To determine if this procedure is covered under Warranty, always refer to the Warranty Policies and Procedures Manual ¹⁾					
Model(s)	Year(s)	Eng. Code(s)	Trans. Code(s)	VIN Range From	VIN Range To
eGolf	2015	All	All	All	All
SAGA Coding					
Claim Type:		Use applicable Claim Type ¹⁾			
Service Number:	Damage Code	HST		Damage Location (Depends on Service No.)	
9132	0039	--		Use applicable when indicated in Elsa (L/R)	
Parts manufacturer:		eGolf		WWO ²⁾	
Labor Operation ³⁾ : Update programming			91322599 = 60 TU		
Labor Operation ³⁾ : Charge Battery			27068950 = 10 TU		
Causal Part: Select Labor Operation			913202599		
Diagnostic Time ⁴⁾					
GFF Time expenditure	01500000 = 00 TU max.			NO	
Road Test	01210002 = 00 TU 01210004 = 00 TU			NO	
Technical Diagnosis	01320000 = 00 TU max.			NO	
Claim Comment: Input "As per Technical Bulletin 2040330" in comment section of Warranty Claim.					
¹⁾ Vehicle may be outside any Warranty in which case this Technical Bulletin is informational only ²⁾ Code per warranty vendor code policy. ³⁾ Labor Time Units (TUs) are subject to change with ELSA updates. ⁴⁾ Documentation required per Warranty Policies and Procedures Manual.					



Technical Bulletin

Required Parts and Tools

No special parts required.

Tool Description	Tool No:
Midtronics Battery Tester/Charger	InCharge 940 (INC-940) Or GRX3000VAS
SWE5140 (via ServiceNet)	SD Card 4G – Locally Obtained

Additional Information

All part and service references provided in this Technical Bulletin are subject to change and/or removal. Always check with your Parts Dept. and Repair Manuals for the latest information.

Document Control Revision Table			
Instance Number	Published Date	Version Number	Reason For Update
2040330/2	8/9/16	V911605	Update software.
2040330/1	4/29/15	V911504	Original publication.