



SERVICE BULLETIN

Classification: BT16-025	Reference: NTB16-102	Date: October 28, 2016
-----------------------------	-------------------------	---------------------------

2016 TITAN XD; BUZZ NOISE FROM SUBWOOFER

APPLIED VEHICLE: 2016 Titan XD (A61) - Equipped with subwoofer

IF YOU CONFIRM

With the audio system ON, a buzz/vibration noise is coming from the subwoofer mounting points under the passenger side seat.

NOTE: If this incident should occur,

- The customer may report the noise is coming from the passenger door.
- The noise may be heard inside and outside the vehicle.

ACTION

Install the new subwoofer mounting screws and grommets listed in the PARTS INFORMATION section.

IMPORTANT: The purpose of ACTION above is to give you a quick idea of the work you will be performing. You **MUST** closely follow the entire SERVICE PROCEDURE as it contains information that is essential to successfully completing this repair.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. **NOTE:** If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

SERVICE PROCEDURE

1. Remove the subwoofer.

- Refer to the Electronic Service Manual (ESM), section **AV - Audio, Visual & Navigation System**, for subwoofer removal.

2. Remove the grommets shown in Figure 1.

- Refer to grommet removal steps on the next page.

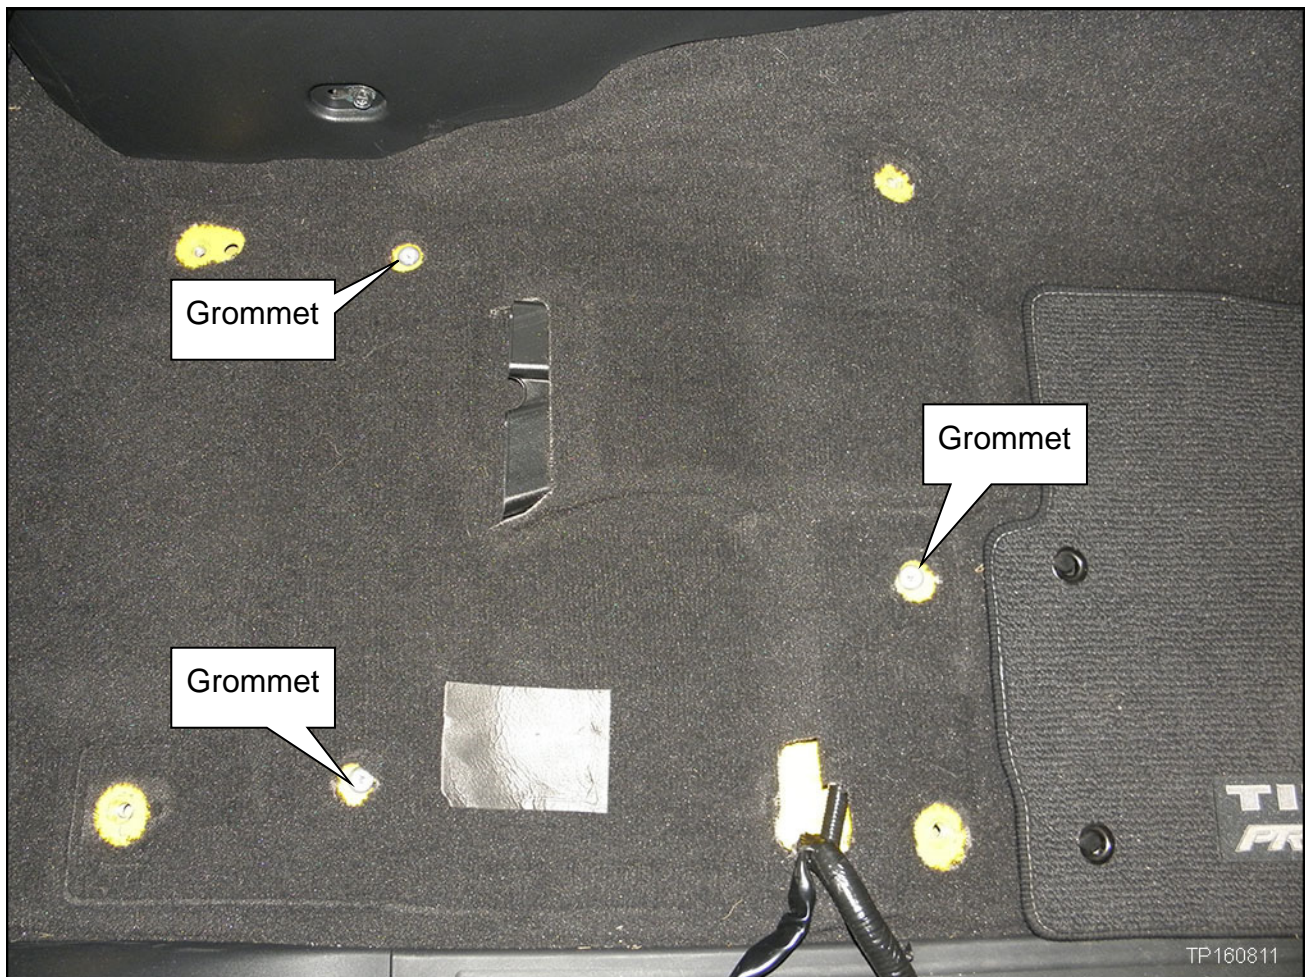


Figure 1

- a. Use a 5/16 drill bit to remove material from the center of each grommet.

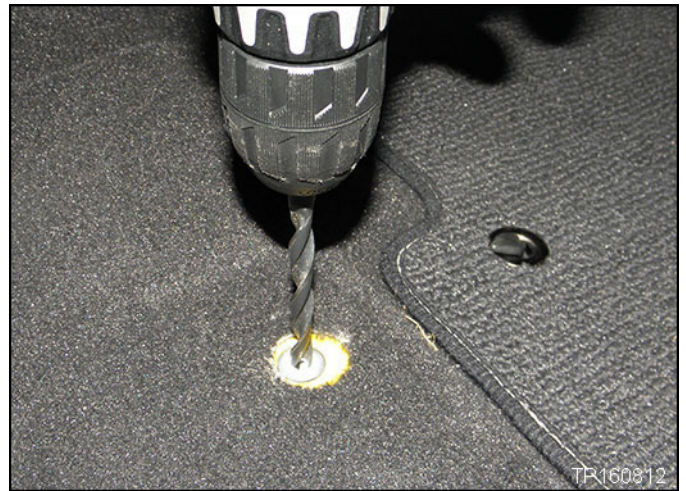


Figure 2

- b. Use a plastic trim tool to raise the edge of the grommets.
- c. Grab the edge of the grommet with needle nose pliers.
- Be careful not to scratch the paint with the needle nose pliers.



Figure 3

- d. Pull the grommet out.
- Be careful not to scratch the paint with the needle nose pliers.



Figure 4

3. Install new grommets.

- New grommets are listed in the PARTS INFORMATION section.
- To install, push them into the existing holes.

4. Use new course threaded screws to reinstall the subwoofer.

- New screws are listed in the PARTS INFORMATION section.

5. Re-install other removed parts in reverse order.

PARTS INFORMATION

DESCRIPTION	PART NUMBER	QUANTITY
Screw	08566-6202A	1
Grommet	01281-0003U	1

CLAIMS INFORMATION

Submit a Primary Part (PP) type line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Replace Grommet	74300EZ00A	RX5KAA	ZL	32	0.8