



Technical Journal

TITLE:
Squealing noise from rear brakes at low speed

REF NO: TJ 31007.6.0	ISSUING DEPARTMENT: Technical Service	CAR MARKET: United States and Canada	
PARTNER: 3 US 7510 Volvo Car USA		ISSUE DATE: 2016-06-23	STATUS DATE: 2016-06-28
FUNC GROUP: 5122	FUNC DESC: brake drum; brake disc	Page 1 of 2	

“Right first time in Time”

Attachment

Vehicle Type

Type	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
256							2016-2017		0000561-9999999	201505-201627

CSC Customer Symptom Codes

Code	Description
1P	Brakes/Unusual noise/Rear

VST Operation Number

VST Operation Number	Description
51204-0	Brake pads rear replacment (only for chassi number below 22196)
51216-0	Brake discs rear 2x replacement

DTC Diagnostic Trouble Codes

Rows beginning with * are modified

Note! If using a printed copy of this Technical Journal, first check for the latest online version.



Text

DESCRIPTION:

* This journal is re-written in its entirety.

If symptom of squealing noise occur from the rear brakes during braking (mainly at low speeds), then follow the advice under Service.

New brake disk with changed material was implemented for service 2016 week 24 and in production 2016 week 27.

SERVICE:

For cars with chassis number below 22196:

- replace rear brake discs and rear brake pads according to VIDA.

Note: For cars between chassis number 22196 and production week 2016w27:

- replace only the rear brake discs according to VIDA.

VEHICLE REPORT:

Yes, please submit a Vehicle Report if the service solution described in this TJ has no effect. Use concern area "Vehicle Report" and sub concern area "Support not needed", use function group 5125.

For cars with latest brake disc design (introduction Service 16w24 / Production 16w27):

- If there is a confirmed noise with the new brake disc, send a vehicle report with a clear sound / video recording of the noise.