

Technical Journal

TITLE:

Service Campaign A39773: Audio Module Replacement

REF NO: TJ 31810.1.0			CAR MARKET: United States and Canada	
3 US 7	PARTNER: '510 Volvo Car USA	ISSUE DATE: 2016-07-18	STATUS DATE: 2016-07-21	
FUNC GROUP: 3900 FUNC DESC: Media, navigation and communication		Page	1 of 9	

"Right first time in Time"

Attachment

File Name	File Size
TJ 31810 QBI-TJ31810.pdf	3.88 MB

Vehicle Type

Туре	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
256						2016-2016		0000510-0059891	201505-201551

CSC Customer Symptom Codes

VST Operation Number

DTC Diagnostic Trouble Codes

Rows beginning with * are modified

Note! If using a printed copy of this Technical Journal, first check for the latest online version.

Text

DESCRIPTION:

Volvo Car USA LLC and Volvo Car of Canada Ltd (Volvo) on behalf of Volvo Car Corporation, has decided to launch Service Campaign A39773 on model year 2016 XC90 vehicles equipped with the Premium Sound System.

Technical Journal 31810.1.0



Volvo has identified that a filter diode in the Audio Module (AUD) may fail, resulting in no sound from the audio system.

SERVICE:

The corrective action is to replace the Audio Module.

VEHICLE REPORT:

Not required

To view TJ attachment continue to next page. This TJ has one attachment.

Page 2 of 9 2016-07-21

Volvo Car Customer Service QB Instruction 31810 Title Audio module (AUD) Action Replacement Operation number: 36004-2 39020-2

Issue	Date	Reason
1	2016-06	First issue

Affected vehicles


Model year	Model
2016	XC90 (16-)

QB Instruction 31810 Page 2 (7)

Removal


Note! Removal steps in this procedure may contain installation details.

Orientation view

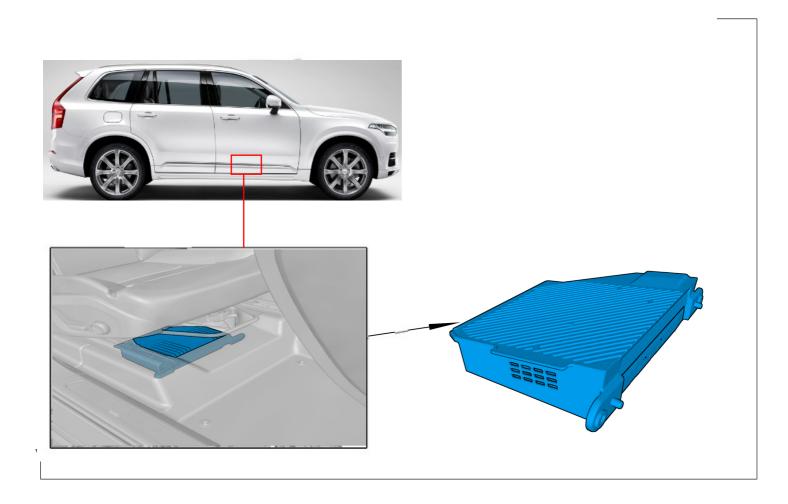


QB Instruction 31810 Page 3 (7)

Color symbols

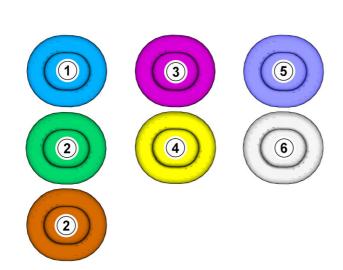


Note! This colour chart displays (in colour print and electronic version) the importance of the different colours used in the images of the method steps.


- Used for focused component, the component with which you will do something.
- 2. Used as extra colors when you need to show or differentiate additional parts.
- Used for attachments that are to be removed/installed. May be screws, clips, connectors, etc.
- 4 . Used when the component is not fully removed from the vehicle but only hung to the side.
- 5. Used for standard tools and special tools.
- 6 . Used as background color for vehicle components.

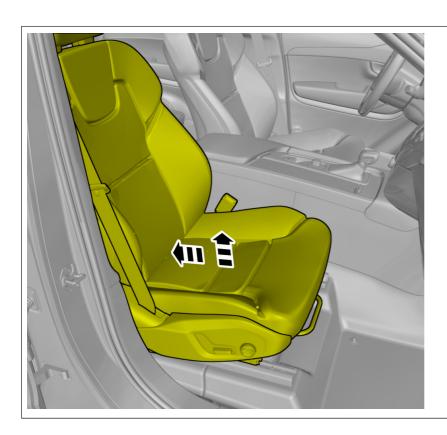

QB Instruction 31810 Page 4 (7)

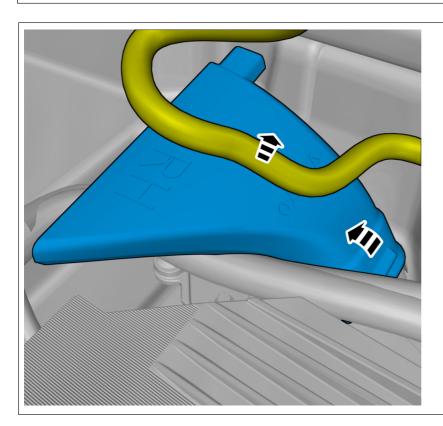


Remove the marked part.

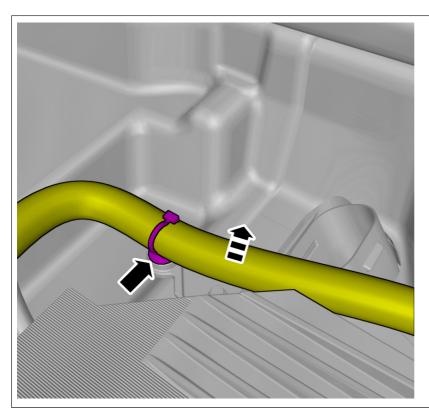

Remove the cable harness clips.


QB Instruction 31810 Page 5 (7)

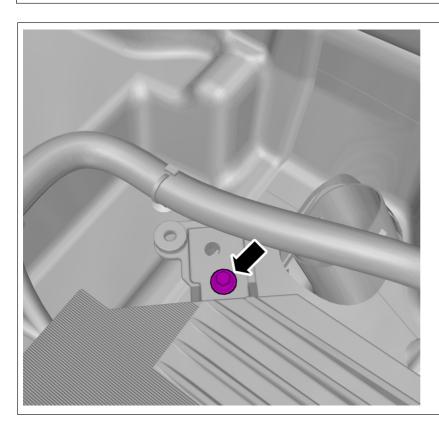


Remove the screw.

Torque:

M5 , 5 Nm

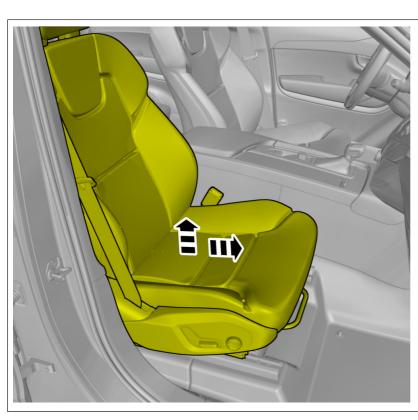

QB Instruction 31810 Page 6 (7)

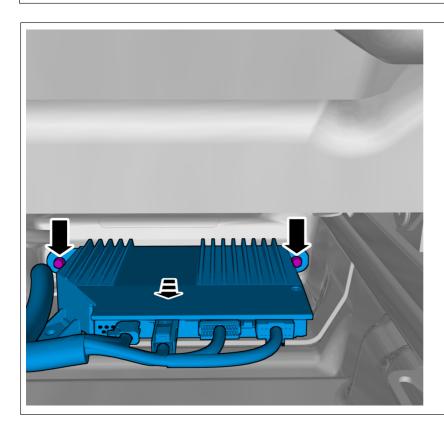

Remove the screws.

Torque:

M6, 10 Nm

Set the vehicle to Inactive mode, described in user mode, refer to:


General Information

3 - Electrical system

30 - General

300 - general

QB Instruction 31810 Page 7 (7)

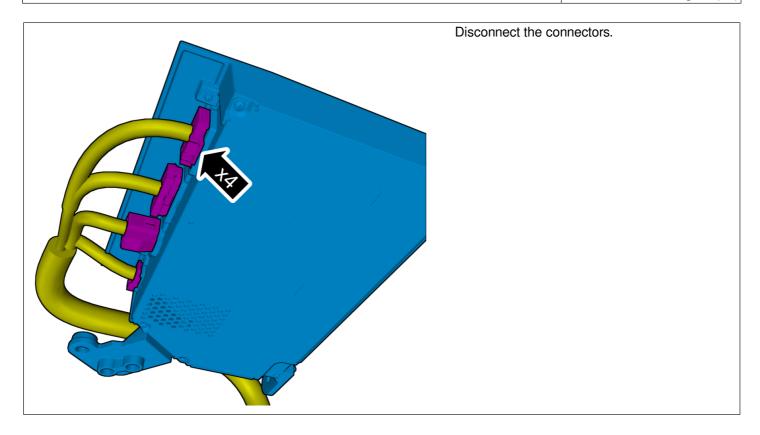

Installation

To install, reverse the removal procedure.
Reset the vehicle settings after completed test
or work.
Order and download software according to:
VIDA/Software/Hardware Changes