

# **Technical Journal**

#### TITLE:

# Front door non-laminated glass, rattling noise in down position

REF NO: TJ 30762.2.0			CAR MARKET: United States and Canada	
3 US 7	PARTNER: 7510 Volvo Car USA	ISSUE DATE: 2016-07-18	STATUS DATE: 2016-07-22	
FUNC GROUP:  8455  Guide moulding for door glass; sealing		Page <sup>-</sup>	1 of 10	

"Right first time in Time"

#### **Attachment**

File Name	File Size
Felt tape.PNG	0.2105 MB
TJ 30762.pdf	2.5711 MB

#### **Vehicle Type**

Туре	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	C'hassis range	Struc Week Range
256						2016-2017		0000561-0124068	201505-201626

# **CSC** Customer Symptom Codes

Code	Description
G8	Doors/Squeak/rattle/Front side door

## **VST** Operation Number

VST Operation Number	Description
98616-2	Window, front doors adjust acc. to TJ30762

# **Technical Journal 30762.2.0**



## **DTC** Diagnostic Trouble Codes

Rows beginning with \* are modified

Note! If using a printed copy of this Technical Journal, first check for the latest online version.

#### **Text**

#### **DESCRIPTION:**

\*Added structure week end point.

A rattling noise may occur while closing the front door with the window in down position. Only vehicles with non-laminated glass can be affected.

#### **SERVICE:**

Add a felt tape P/N 30788314 (max 2 mm thickness) on the front door glass run channel according to attached service instruction.

#### **VEHICLE REPORT:**


Yes, please submit a Vehicle Report if the service solution described in this TJ has no effect. Use concern area "Vehicle Report" and sub concern area "Support not needed", use function group 8455.

To view TJ attachment continue to next page. This TJ has two attachments.

Page 2 of 10 2016-07-22



# **Technical Journal 30762.2.0**

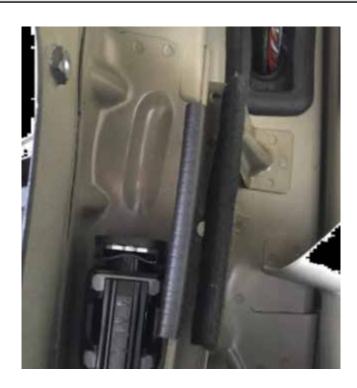

2016-07-22 Page 3 of 10

# Volvo Car Customer Service TJ 30762

Title	Window, front door.	Page	1 (7)
Action	Adjustment	Operation number:	98616-2

Issue	Date	Reason
1	2015-10	First issue

# **Affected vehicles**

Model year	Model
2016	XC90 (16-)

# **Materials**


Materials	Qty.	Part No.	Notes
Anti-squeak tape	0.1	30788314	

TJ 30762 Page 2 ( 7 )

# Adjustment


Note! Removal steps in this procedure may contain installation details.

### Orientation view

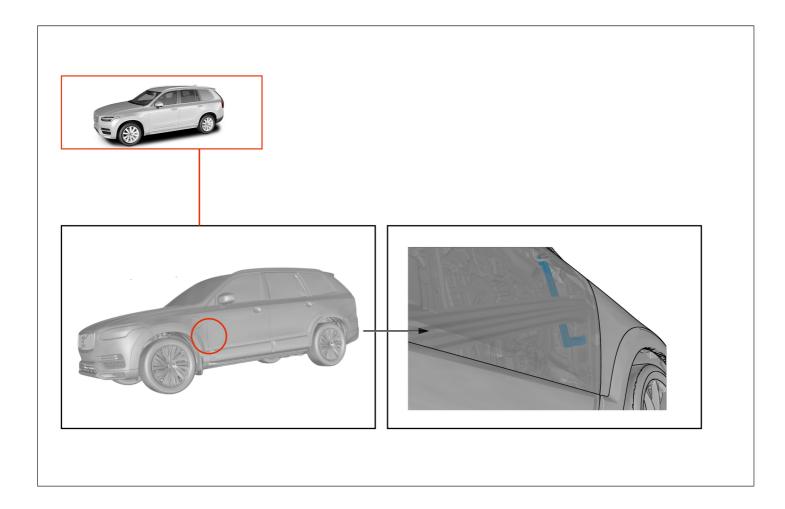

TJ 30762 Page 3 (7)

#### Image philosophy

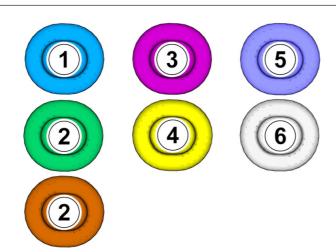


Note! This colour chart displays (in colour print and electronic version) the importance of the different colours used in the images of the method steps.

- Used for focused component, the component with which you will do something.
- 2 . Used as extra colors when you need to show or differentiate additional parts.
- 3 . Used for attachments that are to be removed/installed. May be screws, clips, connectors, etc.
- 4 . Used when the component is not fully removed from the vehicle but only hung to the side.
- 5. Used for standard tools and special tools.
- 6 . Used as background color for vehicle components.

#### Removal

Note! Removal steps in this procedure may contain installation details.

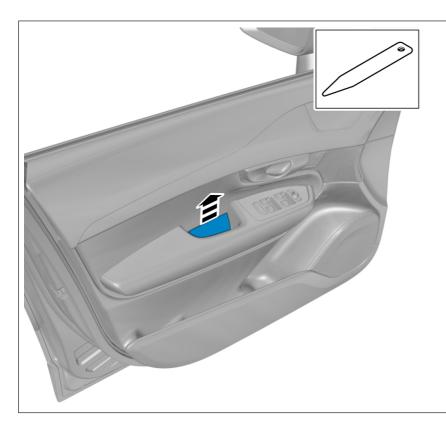


On both sides.
Remove the panel.


TJ 30762 Page 4 ( 7 )




Remove the screws.

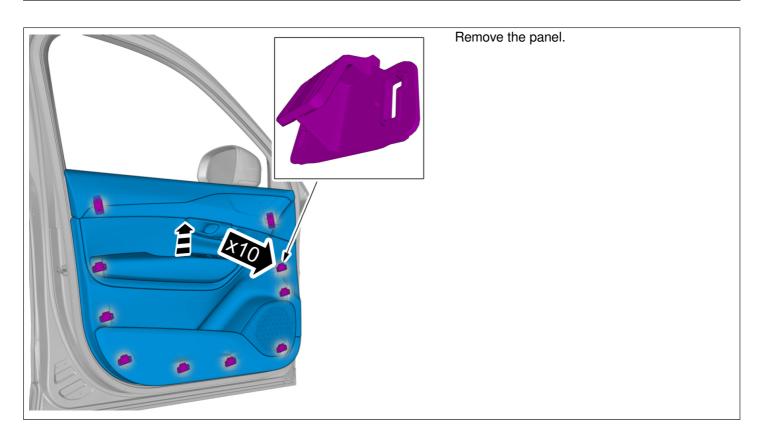

TJ 30762 Page 5 ( 7 )

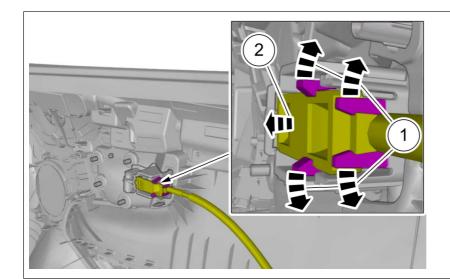


Release the catches.
Fold marked part to one side.

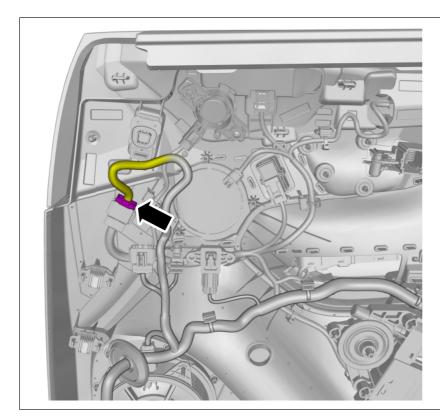


Disconnect the connector.

TJ 30762 Page 6 ( 7 )

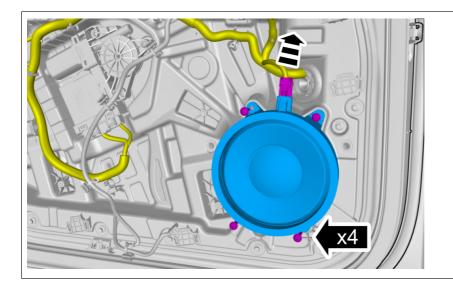


Disconnect the connector. Remove the screws.

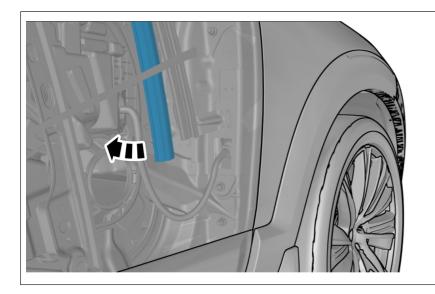

Fold marked part to one side.

TJ 30762 Page 7 ( 7 )

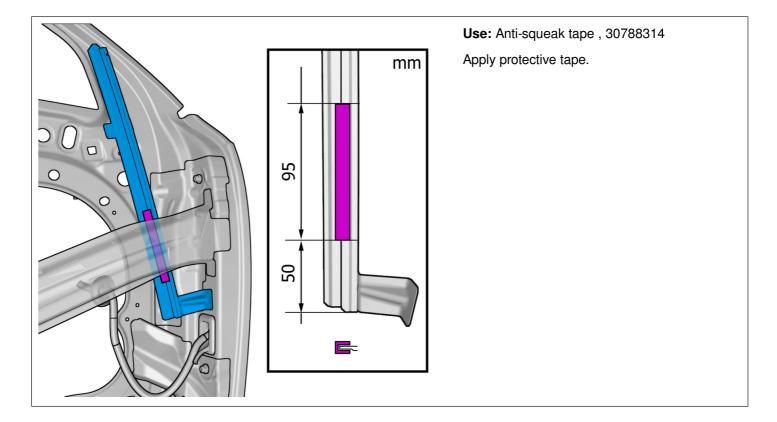

Installation

To install, reverse the removal procedure.