VOLVO CAR SERVICE AND PARTS BUSINESS



# **Technical Journal**

### TITLE: Oil leakage from plug in Variable Valve Timing pulley

REF NO:	ISSUING DEPARTMENT:		ARKET:
TJ 29131.3.0	Technical Service		s and Canada
3 US 7	PARTNER:	ISSUE DATE:	STATUS DATE:
	7510 Volvo Car USA	2016-08-08	2016-08-09
FUNC GROUP: 2150	FUNC DESC: Transmission	Page	1 of 9

#### "Right first time in Time"

#### Attachment

File Name	File Size
TJ29131-1.jpg	0.1172 MB
TJ29131-2.jpg	0.0799 MB
TJ29131-3.jpg	0.2098 MB
TJI-475358-1_1_0_en-US.pdf	0.7726 MB

#### Vehicle Type

Туре	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
138	40	B4204T11					2016-2016	36	0097323-0103481	201535-201550
1XX	26						2015-2015		-	201346-201406
1XX	40						2015-2015		-	201346-201406
1XX	40						2016-2016		0000001-99999999	201533-201538
1XX	49						2015-2015		-	201346-201406
256	A2	B4204T27					2016-2016	21	0000001-9999999	201533-201538

#### **CSC** Customer Symptom Codes

Code	Description
BU	Lubrication and oil system/Incorrect fluid level
J9	Lubrication and oil system/Oil leakage

Produced in the USA and available as an electronic document. Hard copy documents are printed in USA on recycled paper containing a minimum of 50% wastepaper and 10% post-consumer waste. © 2016 VOLVO CAR USA, LLC



#### VST Operation Number

VST Operation Number	Description
36050-2	Calibrating/Identifying with VIDA
98533-2	Plug VVT-Units, inc. camshaft belt and cleaning acc. to TJ29131
98532-2	Plug VVT-units replace acc. to TJ29131

#### **DTC** Diagnostic Trouble Codes

Rows beginning with \* are modified

Note! If using a printed copy of this Technical Journal, first check for the latest online version.

#### Text

#### **DESCRIPTION:**

#### Vehicle types added under VEHICLE TYPE.

Customer may experience a low oil level warning in DIM and /or oil leakage from the engine. The oil may leak due to a crack in the plug from the VVT pulley (see attached photo).


#### **SERVICE:**

Replace both plugs in both VVT-pulleys according to the attached instruction. Plug PN:31375877 If the timing belt is effected with oil, replace the timing belt according to VIDA instructions.

#### **VEHICLE REPORT:**

Yes, please submit a Vehicle Report if the service solution described in this TJ has no effect. Use concern area "Vehicle Report" and sub concern area "Support not needed", use function group 2150.

To view TJ attachment continue to next page. This TJ has four attachments.

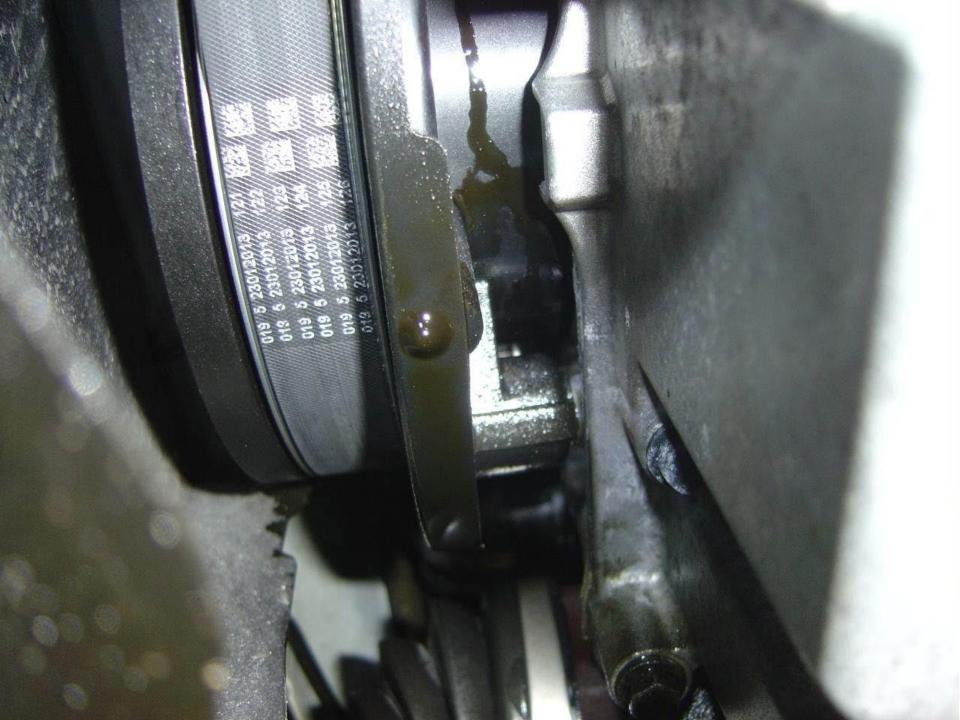





VOLVO	Volvo Car Customer Service	TJ Instruction VC	C-475358-1
Title	Plug VVT unit	Page	1(4)
Action	Product fix	Operation number:	98532-2
			98533-2
			36050-2

Issue	Date	Reason
1	2014-06	First issue

#### Affected vehicles

Г

Model year	Model	Engine
2015	S60 (11-)	B4204T11, T12, T9
2015	S80 (07-)	B4204T11, T12
2015	V60	B4204T11, T12, T9
2015	XC60	B4204T11, T12, T9
2015	XC70 (08-)	B4204T11
2016	XC90 (16-)	B4204T27, B1BPHEV

#### Materials

Materials	Qty.	Part No.	Notes
Plug	2.0	31375877	
Engine oil	0.5	31392923	(CN only 933382831);


#### TJ Instruction VCC-475358-1

Removal


Note! Removal steps in this procedure may contain installation details.
Remove right front wheel, refer to:
Removal, replacement and installation
7 - Springs and wheels
77 - Wheels, tyres, hubs
771 - wheel and wheel trim
Remove engine pad right, refer to:
Removal, replacement and installation
2 - Engine with mountings and equipment

218 - engine mounting Remove the auxiliaries belt, refer to: Removal, replacement and installation 2 - Engine with mountings and equipment 21 - Engine 215 - transmission

21 - Engine

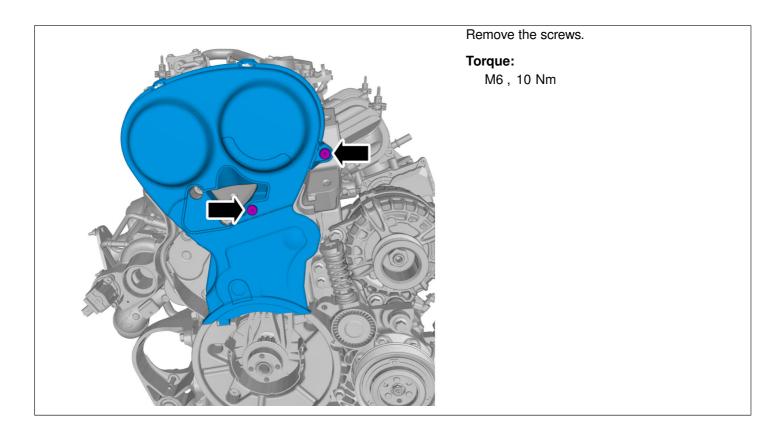

#### TJ Instruction VCC-475358-1

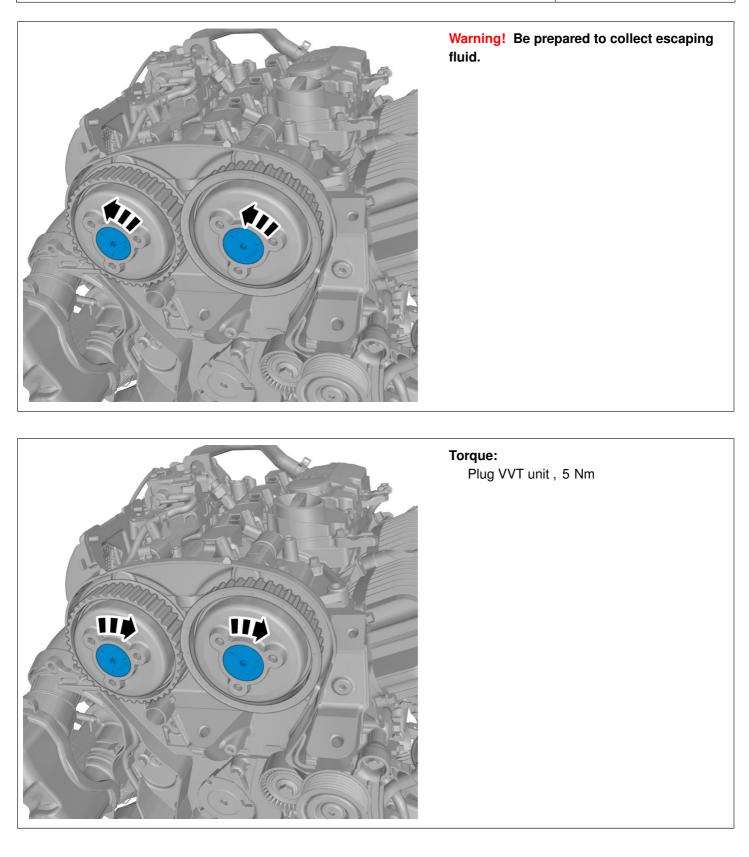

#### Page 3 ( 4 )

#### TJ Instruction VCC-475358-1

## Note! Make sure that the component is clean, free of foreign material and lubricant.



#### Installation

To install, reverse the removal procedure.

Check the oil level according to: VIDA/ DIAGNOSTICS/VEHICLE COMMUNICATION/ ECM/Advanced/General/Miscellaneous

