



# Technical Journal

TITLE:  
**Squealing noise from rear brakes at low speed**

<b>REF NO:</b> TJ 31007.8.0	<b>ISSUING DEPARTMENT:</b> Technical Service	<b>CAR MARKET:</b> United States and Canada	
<b>PARTNER:</b> 3 US 7510 Volvo Car USA		<b>ISSUE DATE:</b> 2016-07-14	<b>STATUS DATE:</b> 2016-08-17
<b>FUNC GROUP:</b> 5122	<b>FUNC DESC:</b> brake drum; brake disc	Page 1 of 2	

“Right first time in Time”

## Attachment

## Vehicle Type

Type	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
256							2016-2017		0000561-0124123	201505-201626

## CSC Customer Symptom Codes

Code	Description
1P	Brakes/Unusual noise/Rear

## VST Operation Number

VST Operation Number	Description
51221-3	Brake pads rear replacment (only for chassi number below 22196)
51216-0	Brake discs rear 2x replacement

## DTC Diagnostic Trouble Codes

Rows beginning with \* are modified

Note! If using a printed copy of this Technical Journal, first check for the latest online version.



## Text

### DESCRIPTION:

VIDA= Vehicle Information and Diagnostics for Aftersales

If symptom of squealing noise occur from the rear brakes during braking (mainly at low speeds), then follow the advice under Service.

\* A new brake disk with changed material was introduced from chassis number 124124.

### SERVICE:

\* For chassis numbers below 22196:

- replace rear brake discs and rear brake pads according to VIDA.

\* For chassis numbers between 22196 and 124124:

- replace only the rear brake disc according to VIDA.

\* Parts: Refer to VIDA.

### VEHICLE REPORT:

\* Yes, if the new brake disc is already installed (can be identified with part number 31471815), then submit a Vehicle Report if the service solution described in this TJ has no effect. Use concern area "Vehicle Report" and sub concern area "Support not needed", use function group 5122.

\* Please include a video or sound recording of the noise, include speed, weather conditions and other observations in the vehicle report.